


OIL ANALYSIS REPORT

PALASYN 45 PALATEK 22EE003085 - SCHNEIDER NATIONAL

Component Compressor

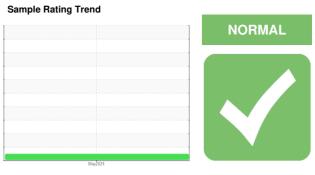

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCS06199346		
Sample Date		Client Info		21 May 2024		
Machine Age	hrs	Client Info		6367		
Oil Age	hrs	Client Info		6367		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0.0	0		
Barium	ppm	ASTM D5185m	0.0	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	0	<1		
Magnesium	ppm	ASTM D5185m	0.0	0		
Calcium	ppm	ASTM D5185m	0.0	0		
Phosphorus	ppm	ASTM D5185m	966	603		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	1309	637		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.172	0.20		

Sullivan

OIL ANALYSIS REPORT

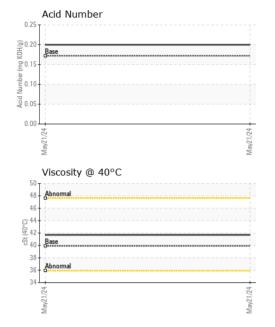



VISUAL		method	limit/base	current	history1	history2
						, =
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	39.9	41.7		
SAMPLE IMAGES		method	limit/base	current	history1	history2


	,	,
Color	no image	no image
Bottom	no image	no image
ODADUO		

GRAPHS



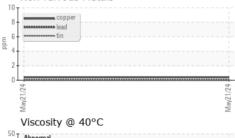

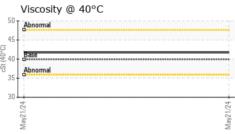

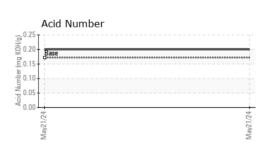





Sample No.

Lab Number : 06199346

: UCS06199346 Unique Number : 11061469

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received : 04 Jun 2024 **Tested** Diagnosed

: 05 Jun 2024 : 05 Jun 2024 - Wes Davis

VACUUM PUMP and COMPRESSOR 1490 GRUBER RD GREEN BAY, WI US 54313

Contact: ROBIN robin@vpc-inc.com T: (920)662-1113

F: (920)662-1116

Certificate 12367

Test Package : IND 2 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCVACGRE [WUSCAR] 06199346 (Generated: 06/05/2024 15:10:09) Rev: 1

Contact/Location: ROBIN ? - UCVACGRE