


OIL ANALYSIS REPORT

SULLUBE [1120359]

SULLAIR 200804090031 - GREAT PLAINS ELLSWORTH Compressor



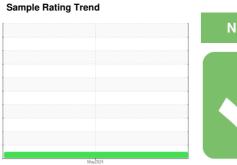

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06199378		
Sample Date		Client Info		08 May 2024		
Machine Age	hrs	Client Info		91665		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATION	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>15	1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	500	634		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		1		
Calcium	ppm	ASTM D5185m		3		
Phosphorus	ppm	ASTM D5185m		<1		
Zinc	ppm	ASTM D5185m		7		
Sulfur	ppm	ASTM D5185m	150	341		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		75		
Potassium	ppm	ASTM D5185m	>20	7		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.5	0.66		



OIL ANALYSIS REPORT

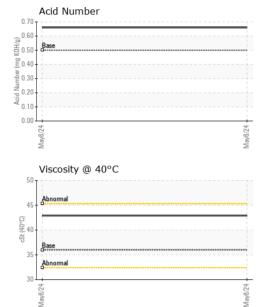



VISUAL		method	limit/base	our root	historia	history?
VISUAL		method	iiiiii/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	LIGHT		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FILLID DECDEEDTIES						111
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	36	42.9		
SAMPLE IMAGES		method	limit/base	current	history1	history2

no image Color no image **Bottom** no image no image **GRAPHS**

Ferrous Alloys



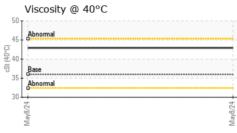

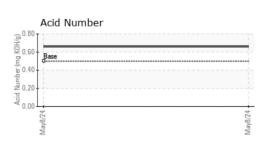





Certificate 12367

Laboratory

Unique Number : 11061501 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 **Sample No.** : UCH06199378 Lab Number : 06199378

Received : 04 Jun 2024 Tested : 05 Jun 2024

Diagnosed : 05 Jun 2024 - Wes Davis

mstout@aircapeq.com T: (316)522-1111

AIR CAPITAL EQUIPMENT INC

Contact: MIKAYLA STOUT

806 E BOSTON ST

WICHITA, KS

US 67211

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)