






KANSAS/44/EG - TRUCK-OFF-HWY-HEAVY HAUL 69.98L [KANSAS^44^EG - TRUCK-OFF-HWY-HEAVY HAUL]

Transfer Case

MOBIL MOBILTRANS AST 30 (--- GAL)

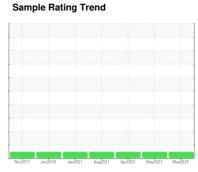



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

A01 00 (GAL)				majava		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0908881	WC0781149	WC0781087
Sample Date		Client Info		29 May 2024	16 May 2023	14 Apr 2023
Machine Age	hrs	Client Info		7742	7081	6986
Oil Age	hrs	Client Info		1622	6120	865
Oil Changed		Client Info		Not Changd	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	٧	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	27	23	30
Chromium	ppm	ASTM D5185m	>5	0	0	<1
Nickel	ppm	ASTM D5185m	>5	0	0	0
Titanium	ppm	ASTM D5185m		0	<1	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>45	<1	0	<1
Lead	ppm	ASTM D5185m	>150	4	2	3
Copper	ppm	ASTM D5185m	>100	20	13	13
Tin	ppm	ASTM D5185m	>5	2	<1	<1
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		38	36	38
Barium	ppm	ASTM D5185m		<1	0	0
Molybdenum	ppm	ASTM D5185m		<1	<1	2
Manganese	ppm	ASTM D5185m		1	<1	1
Magnesium	ppm	ASTM D5185m		17	15	22
Calcium	ppm	ASTM D5185m		3070	2936	2940
Phosphorus	ppm	ASTM D5185m		1114	945	1002
Zinc	ppm	ASTM D5185m		1251	1172	1241
Sulfur	ppm	ASTM D5185m		5941	5665	6301
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>85	8	11	12
Sodium	ppm	ASTM D5185m		2	3	2
Potassium	ppm	ASTM D5185m	>20	<1	0	0
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	Submitted By: S	HAWNE SOUTI





OIL ANALYSIS REPORT

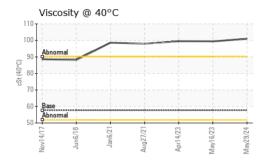


Visc @ 40°C				current	history1	history2
-	cSt	ASTM D445	57.6	101	99.4	99.5
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color				no image	no image	no image
Bottom				no image	no image	no image

GRAPHS

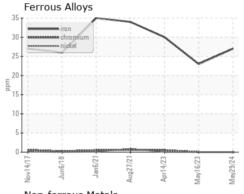

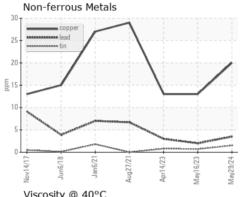

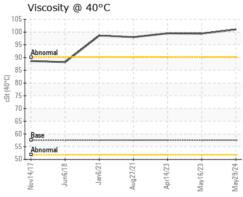





Laboratory

Sample No. : WC0908881 Lab Number : 06200648 Unique Number : 11062771 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received : 05 Jun 2024 **Tested** : 06 Jun 2024 Diagnosed

: 06 Jun 2024 - Wes Davis

SHERWOOD CONSTRUCTION CO INC 3219 WEST MAY ST

WICHITA, KS US 67213 Contact: DOUG KING

doug.king@sherwood.net T: (316)617-3161

Certificate 12367

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: SHEWIC [WUSCAR] 06200648 (Generated: 06/07/2024 21:49:56) Rev: 1

Submitted By: SHAWN SOUTH

F: x: