


OIL ANALYSIS REPORT





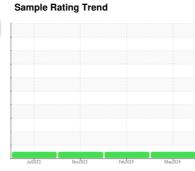

Machine Id **HEB MLU1** Component Lube System

{not provided} (--- GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Jul202	3 Nov2023	Feb 2024 M	ay2024	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0036058	RP0039982	RP0033138
Sample Date		Client Info		30 May 2024	27 Feb 2024	16 Nov 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	0	0
Chromium	ppm	ASTM D5185m	>20	0	0	0
Nickel	ppm	ASTM D5185m	>20	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	0	<1	0
Lead	ppm	ASTM D5185m	>20	<1	0	0
Copper	ppm	ASTM D5185m	>20	1	1	2
Tin	ppm	ASTM D5185m	>20	1	2	<1
Vanadium	ppm	ASTM D5185m		<1	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	<1
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	<1	0
Magnesium	ppm	ASTM D5185m		70	69	72
Calcium	ppm	ASTM D5185m		8	6	9
Phosphorus	ppm	ASTM D5185m		8	5	8
Zinc	ppm	ASTM D5185m		22	13	19
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2	1	2
Sodium	ppm	ASTM D5185m		2	0	3
Potassium	ppm	ASTM D5185m	>20	0	0	0
Water	%	ASTM D6304	>0.05	0.017	0.010	0.012
ppm Water	ppm	ASTM D6304	>500	179	108	127
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.31	0.30	0.29
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
Linaiomoa viator	Juanan	Visuai	<i>></i> 0.00	NEG	on: Service Mar	



OIL ANALYSIS REPORT

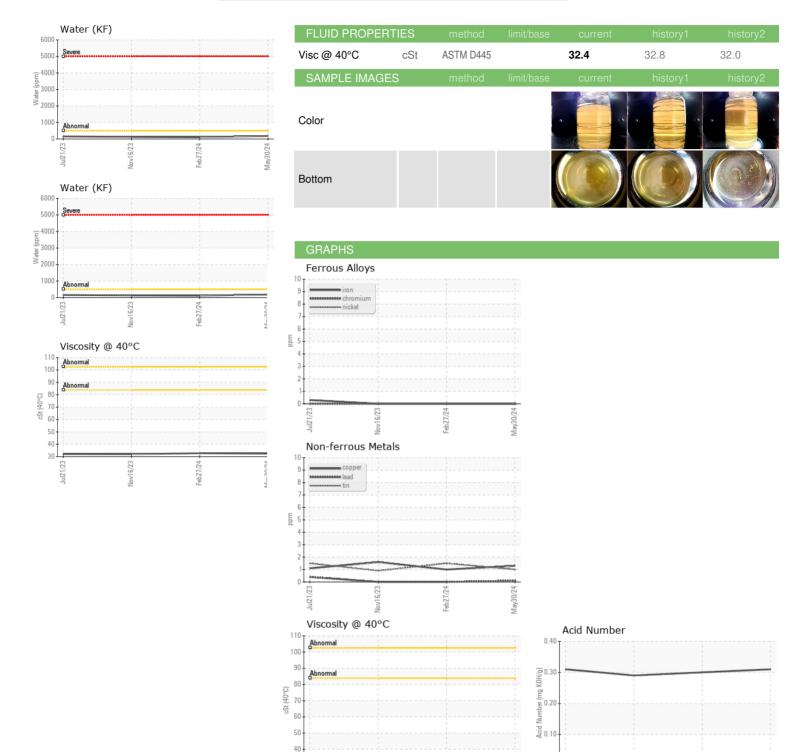





Certificate 12367

Laboratory Sample No.

Lab Number : 06202839

30

: RP0036058

Unique Number : 11070300

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 07 Jun 2024 **Tested** : 10 Jun 2024

Diagnosed : 10 Jun 2024 - Don Baldridge

0.00

ENERGY TRANSFER - HEBRON

HEBRON, KY US 41048 Contact: Service Manager

Test Package : IND 2 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: ENEHEB [WUSCAR] 06202839 (Generated: 06/10/2024 13:42:06) Rev: 1

Contact/Location: Service Manager - ENEHEB

T:

F: