


# **OIL ANALYSIS REPORT**

Sample Rating Trend





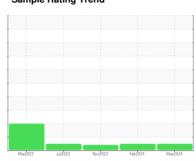

Machine Id

# LIM MLU1 LIM MLU1 Component Outboard Pump

{not provided} (--- GAL)

		SIS	

## Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

## Contamination

The water content is negligible. There is no indication of any contamination in the oil.


## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Mar2023	Jul2023	Nov2023 Feb2024	May2024	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0037263	RP0039820	RP0032522
Sample Date		Client Info		29 May 2024	29 Feb 2024	14 Nov 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	11	10	14
Chromium	ppm	ASTM D5185m	>5	0	0	0
Nickel	ppm	ASTM D5185m	>5	0	0	0
Titanium	ppm	ASTM D5185m	>3	0	0	<1
Silver	ppm	ASTM D5185m	>3	0	0	0
Aluminum	ppm	ASTM D5185m	>7	0	0	0
Lead	ppm	ASTM D5185m	>12	2	3	4
Copper	ppm	ASTM D5185m	>30	_ 15	17	22
Tin	ppm	ASTM D5185m	>9	4	1	2
Vanadium	ppm	ASTM D5185m	-	<1	0	- <1
Cadmium	ppm	ASTM D5185m		0	<1	<1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		34	42	19
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		26	28	26
Zinc	ppm	ASTM D5185m		37	36	46
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>60	<1	0	<1
Sodium	ppm	ASTM D5185m		2	0	2
Potassium	ppm	ASTM D5185m	>20	0	0	0
Water	%	ASTM D6304	>.1	0.008	0.008	0.019
ppm Water	ppm	ASTM D6304	>1000	82	86	191
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.32	0.33	0.31
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	▲ MODER
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	INDBER MADI	



## **OIL ANALYSIS REPORT**

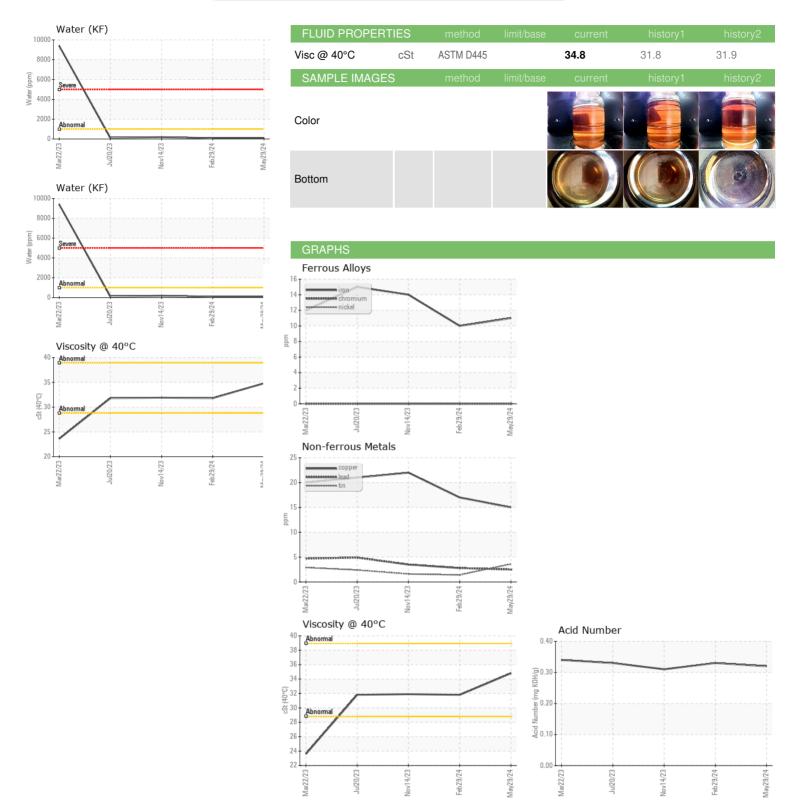





Certificate 12367

Laboratory Sample No.

Lab Number : 06202848 Unique Number : 11070309 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : RP0037263 Received : 07 Jun 2024

**Tested** : 10 Jun 2024 Diagnosed

: 10 Jun 2024 - Don Baldridge

US 45804 Contact: ANDREW WYDERKA andrew.wyderka@energytransfer.com

**ENERGY TRANSFER - LIMA** 

1520 BUCKEYE RD

T: (419)618-1505 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Report Id: ENELIM [WUSCAR] 06202848 (Generated: 06/10/2024 13:45:11) Rev: 1

Contact/Location: ANDREW WYDERKA - ENELIM

LIMA, OH

F: