


OIL ANALYSIS REPORT

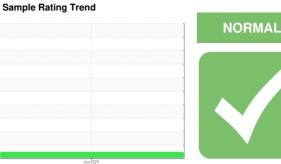

Machine Id

[] Oil room tote 29

Bulk Fluid Tank

ROYAL PURPLE BARRIER FLUID GT22 (--- GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

GAL)			J	lun2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0042857		
Sample Date		Client Info		05 Jun 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m		0		
Chromium	ppm	ASTM D5185m		0		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m		0		
_ead	ppm	ASTM D5185m		0		
Copper	ppm	ASTM D5185m		0		
Γin	ppm	ASTM D5185m		0		
/anadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		1		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		3		
Calcium	ppm	ASTM D5185m		<1		
Phosphorus	ppm	ASTM D5185m		198		
Zinc	ppm	ASTM D5185m		5		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m		0		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	2		
Vater	%	ASTM D6304		0.001		
opm Water	ppm	ASTM D6304		5		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.843		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual		NEG		
Free Water	scalar	*Visual		NEG	ubmitted By: CO	DDY <u>C</u> OMPTO
						- :



OIL ANALYSIS REPORT

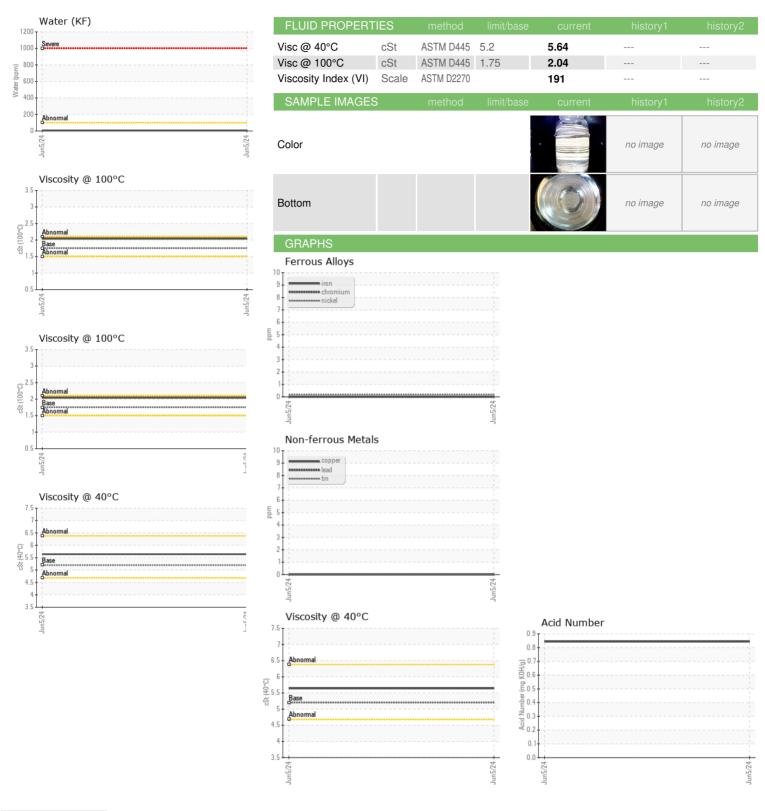



Certificate 12367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06203205

: RP0042857 Unique Number : 11070666

Received **Tested** Diagnosed Test Package : IND 2 (Additional Tests: KV100, VI)

: 07 Jun 2024 : 13 Jun 2024

: 13 Jun 2024 - Angela Borella

CALUMET 3333 MIDWAY AVENUE SHREVEPORT, LA US 71109 Contact: NICHOLAS LESAGE

nicholas.lesage@clmt.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: