




OIL ANALYSIS REPORT

Sample Rating Trend

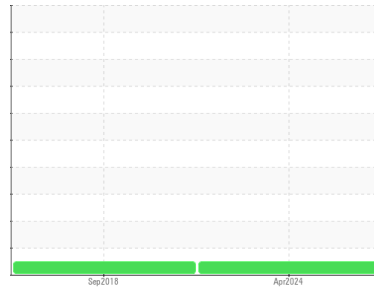

NORMAL



Machine Id
TRANE CLOVER HILL HS CHILLER 1 (S/N L08D1745)
 Component
Refrigeration Compressor
 Fluid
TRANE 0022 (10 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0812058	WCI2309235	---
Sample Date	Client Info		03 Apr 2024	04 Sep 2018	---
Machine Age	hrs	Client Info	27266	0	---
Oil Age	hrs	Client Info	0	0	---
Oil Changed	Client Info		Not Changed	Changed	---
Sample Status			NORMAL	NORMAL	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >8	<1	4	---
Chromium	ppm	ASTM D5185m >2	0	0	---
Nickel	ppm	ASTM D5185m	0	0	---
Titanium	ppm	ASTM D5185m	<1	0	---
Silver	ppm	ASTM D5185m >2	0	0	---
Aluminum	ppm	ASTM D5185m >3	0	0	---
Lead	ppm	ASTM D5185m >2	<1	0	---
Copper	ppm	ASTM D5185m >8	2	2	---
Tin	ppm	ASTM D5185m >4	6	4	---
Antimony	ppm	ASTM D5185m	---	0	---
Vanadium	ppm	ASTM D5185m	<1	0	---
Cadmium	ppm	ASTM D5185m	0	0	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	<1	---
Barium	ppm	ASTM D5185m	0	0	---
Molybdenum	ppm	ASTM D5185m	0	0	---
Manganese	ppm	ASTM D5185m	<1	<1	---
Magnesium	ppm	ASTM D5185m	0	0	---
Calcium	ppm	ASTM D5185m	0	0	---
Phosphorus	ppm	ASTM D5185m	0	0	---
Zinc	ppm	ASTM D5185m	0	0	---
Sulfur	ppm	ASTM D5185m	0	0	---

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	2	8	---
Sodium	ppm	ASTM D5185m	1	<1	---
Potassium	ppm	ASTM D5185m >20	1	0	---
Water	%	ASTM D6304 >0.005	0.001	0.004	---
ppm Water	ppm	ASTM D6304 >50	9	40	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974	0.014	0.061	---




OIL ANALYSIS REPORT

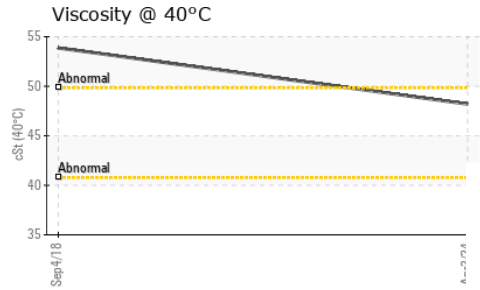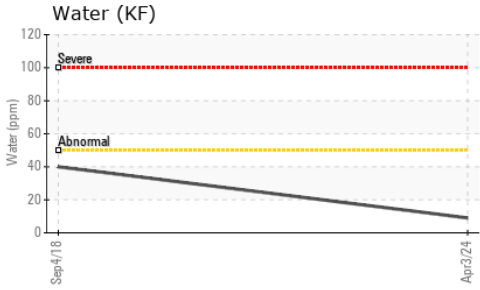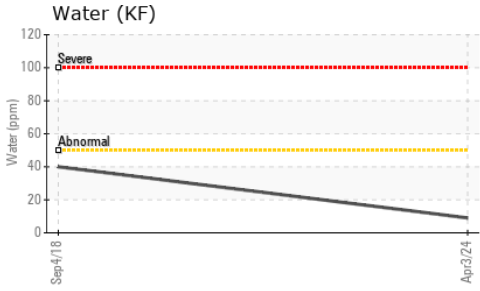





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.005	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	48.2	53.87	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

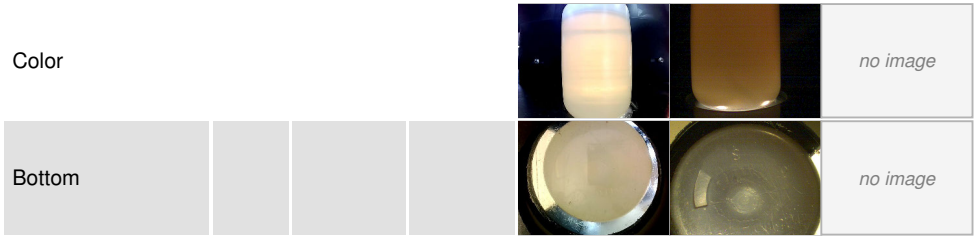

GRAPHS

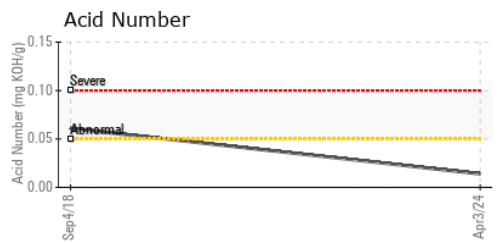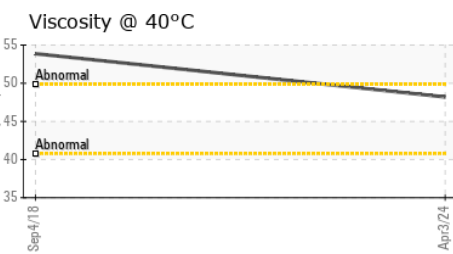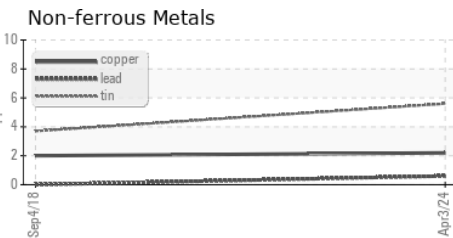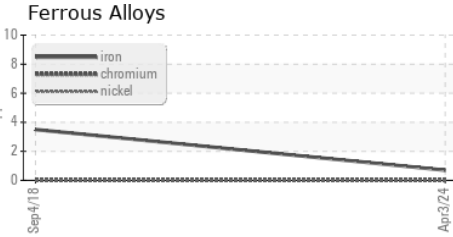

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0812058 **Received** : 10 Jun 2024
Lab Number : 06204762 **Tested** : 12 Jun 2024
Unique Number : 11072223 **Diagnosed** : 12 Jun 2024 - Angela Borella
Test Package : IND 2

DAIKIN APPLIED-RICHMOND
 8991 OLD STAPLES MILL ROAD
 HENRICO, VA
 US 23228
 Contact: AMANDA CARRIER
 amanda.carrier@daikinapplied.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (804)747-4822
F: (804)747-6686