


OIL ANALYSIS REPORT

Acid Number (AN)

mg KOH/g ASTM D8045 0.200

AIRLUBE COOLANT PE [S-2469813] INGERSOLL RAND CBV155481 - SCHNEIDER ELECTRIC

Component

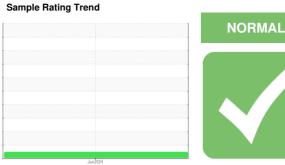

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06204792		
Sample Date		Client Info		06 Jun 2024		
Machine Age	hrs	Client Info		45457		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>25	2		
Copper	ppm	ASTM D5185m	>50	11		
Tin	ppm	ASTM D5185m	>15	1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	700	492		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	0	<1		
Magnesium	ppm	ASTM D5185m	0	0		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	82		
Sulfur	ppm	ASTM D5185m	630	592		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		29		
Potassium	ppm	ASTM D5185m	>20	5		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

0.274





OIL ANALYSIS REPORT

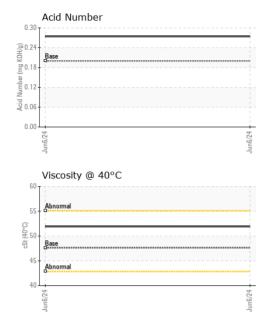



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	47.6	51.9		
SAMPLE IMAGES	3	method	limit/base	current	history1	history2
Color					no image	no image

GRAPHS

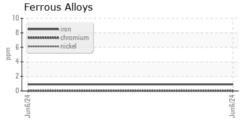

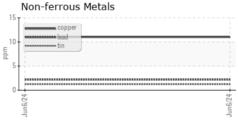

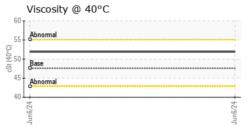

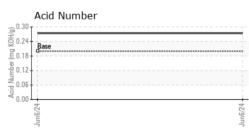





Certificate 12367

Laboratory

Sample No. : UCH06204792 **Lab Number** : 06204792

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Unique Number : 11072253

Received Tested Diagnosed

: 10 Jun 2024 : 11 Jun 2024 : 11 Jun 2024 - Wes Davis **CAPITAL MACHINERY SYSTEMS**

3207 W ANGLE ROAD PENDELTON, IN US 46064

Contact: BRIAN CALDWELL bcaldwell@capital-compressor.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (765)788-0919