

Area


SMART OIL 6000

Machine Id

HERTZ VD033579 - WESTLAKE/DIMEX

Component

Compressor

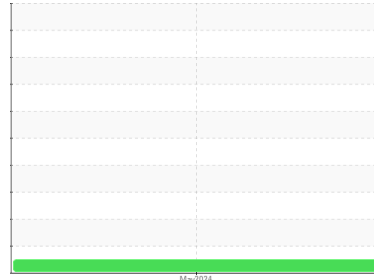

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION method limit/base current history1 history2

Sample Number	Client Info		UHK0000748	---	---
Sample Date	Client Info		31 May 2024	---	---
Machine Age	hrs	Client Info	4227	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		Filtered	---	---
Sample Status			NORMAL	---	---

CONTAMINATION method limit/base current history1 history2

Water	WC Method	>0.1	NEG	---	---
-------	-----------	------	------------	-----	-----

WEAR METALS method limit/base current history1 history2

Iron	ppm	ASTM D5185m	>50	<1	---	---
Chromium	ppm	ASTM D5185m	>10	0	---	---
Nickel	ppm	ASTM D5185m		0	---	---
Titanium	ppm	ASTM D5185m		<1	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m	>25	2	---	---
Lead	ppm	ASTM D5185m	>25	0	---	---
Copper	ppm	ASTM D5185m	>50	<1	---	---
Tin	ppm	ASTM D5185m	>15	<1	---	---
Vanadium	ppm	ASTM D5185m		<1	---	---
Cadmium	ppm	ASTM D5185m		0	---	---

ADDITIVES method limit/base current history1 history2

Boron	ppm	ASTM D5185m		0	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		0	---	---
Manganese	ppm	ASTM D5185m		<1	---	---
Magnesium	ppm	ASTM D5185m		0	---	---
Calcium	ppm	ASTM D5185m	20	0	---	---
Phosphorus	ppm	ASTM D5185m		36	---	---
Zinc	ppm	ASTM D5185m		0	---	---
Sulfur	ppm	ASTM D5185m		306	---	---


CONTAMINANTS method limit/base current history1 history2

Silicon	ppm	ASTM D5185m	>25	<1	---	---
Sodium	ppm	ASTM D5185m		1	---	---
Potassium	ppm	ASTM D5185m	>20	1	---	---

FLUID DEGRADATION method limit/base current history1 history2

Acid Number (AN)	mg KOH/g	ASTM D8045		0.19	---	---
------------------	----------	------------	--	-------------	-----	-----

OIL ANALYSIS REPORT

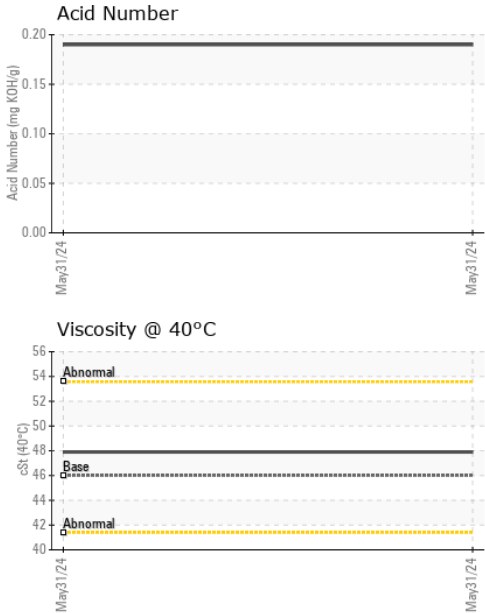





VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---
Precipitate	scalar	*Visual	NONE	NONE	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	LIGHT	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.1	NEG	---	---
Free Water	scalar	*Visual		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D445	46	47.9	---	---

SAMPLE IMAGES

	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

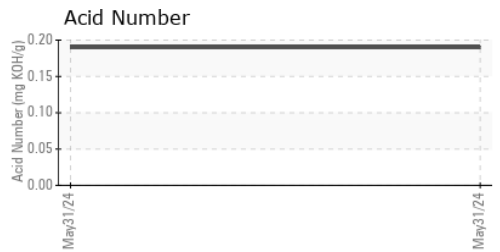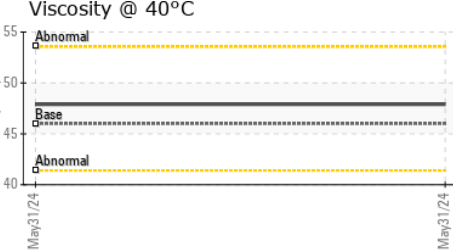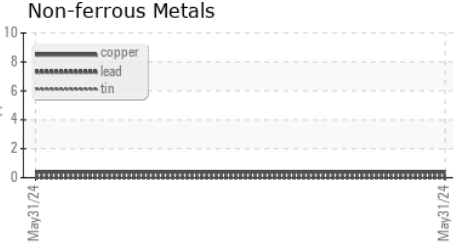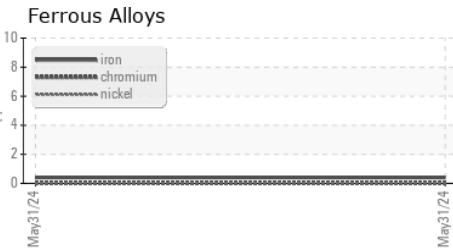

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : UHK0000748 **Received** : 10 Jun 2024
Lab Number : **06204838** **Tested** : 12 Jun 2024
Unique Number : 11072299 **Diagnosed** : 12 Jun 2024 - Sean Felton
Test Package : IND 2

HERTZ KOMPRESSOREN USA INC
 3320 SERVICE ST
 CHARLOTTE, NC
 US 28206
 Contact: WARRANTY
 warranty@hertz-kompressoren.us
 T: (704)579-5900
 F: (704)579-5997

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)