




OIL ANALYSIS REPORT

Sample Rating Trend

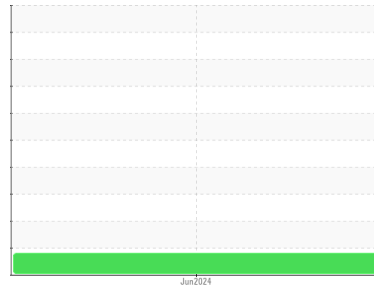

INSOLUBLES



Area

DONNA PENNANT

Machine Id

LS-043024-01A-245C

Component

Chain

Fluid

{not provided} (--- GAL)

DIAGNOSIS

▲ Recommendation

This is a baseline read-out on the submitted sample.

▲ Contamination

MPC (Membrane Patch Colorimetry) test indicates a high concentration of varnish present.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0946777	---	---
Sample Date	Client Info		06 Jun 2024	---	---
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			SEVERE	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
MPC Varnish Potential	Scale	ASTM D7843	>15	▲ 65	---

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---
Free Water	scalar	*Visual		NEG	---

SAMPLE IMAGES

	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image
MPC				no image	no image

MPC (Varnish Test)



Sample Color & Clarity

