


# **OIL ANALYSIS REPORT**



ACS-46-1 [418202] ATLAS COPCO API465123 - LINDEN TRANSLOAD TERMINAL Component Compressor



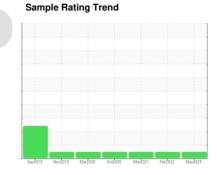

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06206688	UCH05457253	UCH05215758
Sample Date		Client Info		30 May 2024	01 Feb 2022	23 Mar 2021
Machine Age	hrs	Client Info		41712	29300	25280
Oil Age	hrs	Client Info		5986	968	1671
Oil Changed		Client Info		Changed	N/A	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	<1	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	<1	<1
Aluminum	ppm	ASTM D5185m	>25	2	0	0
Lead	ppm	ASTM D5185m	>25	0	0	0
Copper	ppm	ASTM D5185m	>50	<1	<1	<1
Tin	ppm	ASTM D5185m	>15	<1	<1	0
Antimony	ppm	ASTM D5185m			0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0.0	0	3	1
Barium	ppm	ASTM D5185m	0.0	0	5	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m	0	0	0	0
Magnesium	ppm	ASTM D5185m	0.0	0	0	0
Calcium	ppm	ASTM D5185m	0.0	0	0	0
Phosphorus	ppm	ASTM D5185m	966	137	206	229
Zinc	ppm	ASTM D5185m	0	17	39	30
Sulfur	ppm	ASTM D5185m	1309	1665	1725	1683
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1	<1	0
Sodium	ppm	ASTM D5185m		0	<1	0
Potassium	ppm	ASTM D5185m	>20	<1	0	0
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
	1/011/	4 OT1 4 DOC 17	0.470	0.40	0.40	0.005

0.16

Acid Number (AN)


mg KOH/g ASTM D8045 0.172


0.12

0.095



# **OIL ANALYSIS REPORT**

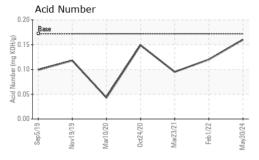


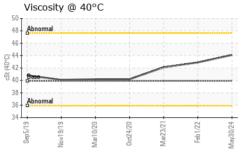



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	39.9	44.1	42.9	42.1
SAMPLE IMAGES		method	limit/base	current	history1	history2


Color




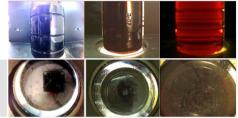

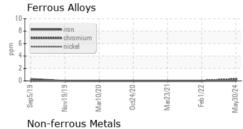

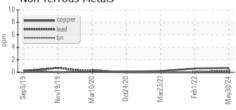

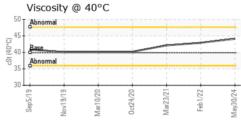

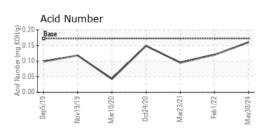





Certificate 12367

Laboratory Sample No. Unique Number : 11074149 Test Package : IND 2

Lab Number : 06206688

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06206688

Received : 11 Jun 2024 **Tested** Diagnosed

: 13 Jun 2024 : 13 Jun 2024 - Sean Felton

700 WASHINGTON AVE CARLSTADT, NJ

**AIRMATIC COMPRESSOR SYSTEMS** 

US 07072 Contact: ELVIN DIAZ

ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com T: (800)864-7621

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

F: (201)342-6241 Contact/Location: ELVIN DIAZ - UCAIRCAR