


OIL ANALYSIS REPORT

XTEND [419645]

ATLAS COPCO ITJ495297 - ENGLEWOOD HOSPITAL

Component Compressor

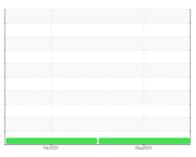

Sample Rating Trend



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06206690	UCH06104414	
Sample Date		Client Info		22 May 2024	28 Feb 2024	
Machine Age	hrs	Client Info		10780	10500	
Oil Age	hrs	Client Info		280	1026	
Oil Changed		Client Info		Not Changd	N/A	
Sample Status				NORMAL	NORMAL	
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	15	
Chromium	ppm	ASTM D5185m	>5	<1	<1	
Nickel	ppm	ASTM D5185m		0	<1	
Titanium	ppm	ASTM D5185m		<1	<1	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>15	2	2	
Lead	ppm	ASTM D5185m	>65	0	<1	
Copper	ppm	ASTM D5185m	>65	<1	<1	
Tin	ppm	ASTM D5185m	>10	<1	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		<1	<1	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	<1	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	<1	
Manganese	ppm	ASTM D5185m		0	<1	
Magnesium	ppm	ASTM D5185m		<1	<1	
Calcium	ppm	ASTM D5185m		0	0	
Phosphorus	ppm	ASTM D5185m		55	443	
Zinc	ppm	ASTM D5185m		34	19	
Sulfur	ppm	ASTM D5185m		65	1467	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	<1	1	
Sodium	ppm	ASTM D5185m		<1	5	
Potassium	ppm	ASTM D5185m	>20	5	<1	
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.26	0.32	





OIL ANALYSIS REPORT

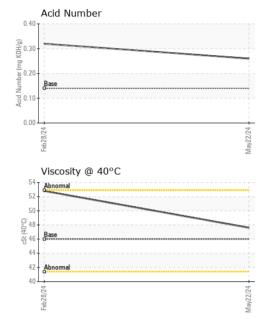

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	NONE	NONE	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	
Free Water	scalar	*Visual		NEG	NEG	
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	47.6	52.8	
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color						no image
Bottom						no image
GRAPHS						

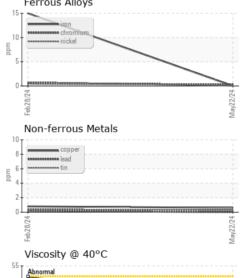

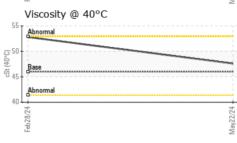

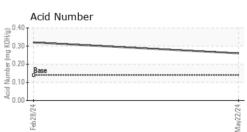





Certificate 12367

Laboratory Sample No.

Test Package : IND 2

Lab Number : 06206690

: UCH06206690 Unique Number : 11074151

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 11 Jun 2024 **Tested** Diagnosed

: 13 Jun 2024 : 13 Jun 2024 - Wes Davis

700 WASHINGTON AVE CARLSTADT, NJ

AIRMATIC COMPRESSOR SYSTEMS

US 07072 Contact: ELVIN DIAZ

ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com

T: (800)864-7621

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (201)342-6241 Contact/Location: ELVIN DIAZ - UCAIRCAR