

OIL ANALYSIS REPORT

ROTO Z [419594]
Machine Id
ATLAS COPCO APFS51036803 - VALLEY ENERGY
Component
Compressor

May/2224

Sample Rating Trend



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06206707		
Sample Date		Client Info		21 May 2024		
Machine Age	hrs	Client Info		22273		
Oil Age	hrs	Client Info		4097		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	2		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	<1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		9		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		460		
Zinc	ppm	ASTM D5185m		11		
Sulfur	ppm	ASTM D5185m		633		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	0		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2


0.26

Acid Number (AN)

mg KOH/g ASTM D8045





OIL ANALYSIS REPORT

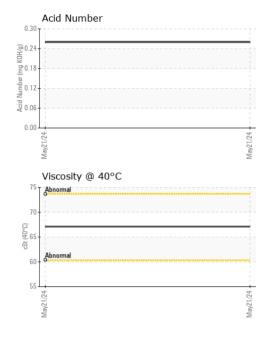


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		67.1		
SAMPLE IMAGES	3	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image

GRAPHS

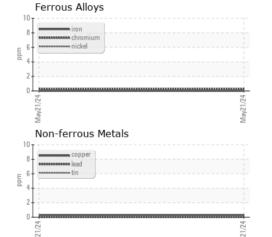

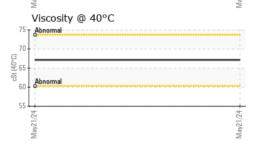

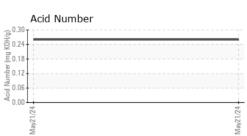





Laboratory Sample No. Lab Number : 06206707

: UCH06206707 Unique Number : 11074168

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 11 Jun 2024

Tested : 13 Jun 2024

Diagnosed : 13 Jun 2024 - Wes Davis

700 WASHINGTON AVE CARLSTADT, NJ US 07072

Contact: ELVIN DIAZ

ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com T: (800)864-7621

AIRMATIC COMPRESSOR SYSTEMS

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (201)342-6241

Contact/Location: ELVIN DIAZ - UCAIRCAR