


# **OIL ANALYSIS REPORT**

**ROTO XTEND [418958]** ATLAS COPCO API831166 - TRI-SEAL

Component Compressor



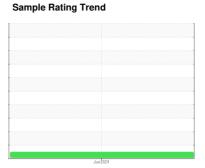

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The condition of the oil is acceptable for the time in service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06206714		
Sample Date		Client Info		10 Jun 2024		
Machine Age	hrs	Client Info		43208		
Oil Age	hrs	Client Info		6976		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	2		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	<1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		12		
Zinc	ppm	ASTM D5185m		30		
Sulfur	ppm	ASTM D5185m		0		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.18		





## **OIL ANALYSIS REPORT**

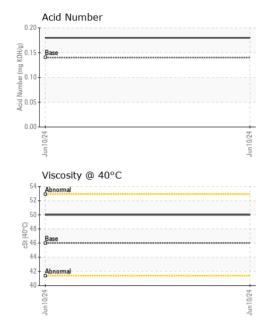



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	50.0		
SAMPLE IMAGES meth		method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image

# GRAPHS

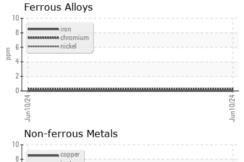

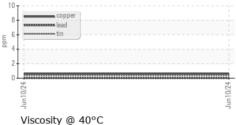

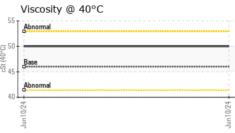

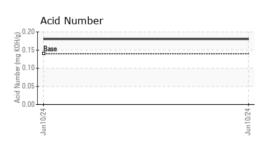





Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06206714 Lab Number : 06206714 Unique Number : 11074175

Received : 11 Jun 2024 Tested : 13 Jun 2024 Diagnosed : 13 Jun 2024 - Angela Borella

700 WASHINGTON AVE CARLSTADT, NJ US 07072 Contact: ELVIN DIAZ

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com T: (800)864-7621

**AIRMATIC COMPRESSOR SYSTEMS** 

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (201)342-6241 Contact/Location: ELVIN DIAZ - UCAIRCAR