


OIL ANALYSIS REPORT

ROTO Z [417553] ATLAS COPCO APF264345 - FIRMENICH US

Component Compressor

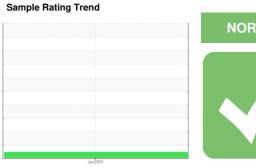

NORMAL

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06206715		
Sample Date		Client Info		10 Jun 2024		
Machine Age	hrs	Client Info		10895		
Oil Age	hrs	Client Info		10895		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	17		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m		3		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	2		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		412		
Zinc	ppm	ASTM D5185m		9		
Sulfur	ppm	ASTM D5185m		536		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	2		
FLUID DEGRADA	TION_	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.17		




OIL ANALYSIS REPORT

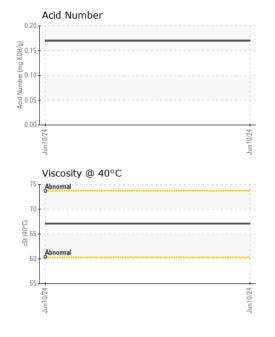



VISUAL		method				history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IEC	mathad	limit/bass	ou innont	historya	history ()
FLUID PHOPENT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		67.1		
SAMPLE IMAGES	;	method	limit/base	current	history1	history2
Color					no image	no image


GRAPHS

Bottom

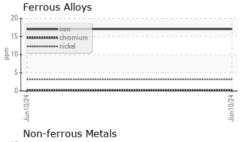

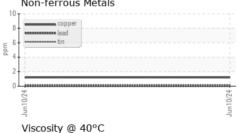

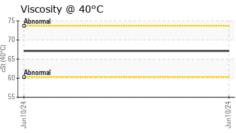

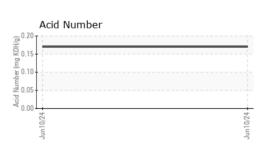

no image

no image





Laboratory Sample No.

Lab Number : 06206715 Unique Number : 11074176

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06206715

Received : 11 Jun 2024 **Tested** Diagnosed

: 13 Jun 2024 : 13 Jun 2024 - Wes Davis 700 WASHINGTON AVE CARLSTADT, NJ

US 07072 Contact: ELVIN DIAZ

F: (201)342-6241

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com T: (800)864-7621

AIRMATIC COMPRESSOR SYSTEMS

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) Report Id: UCAIRCAR [WUSCAR] 06206715 (Generated: 06/15/2024 06:29:50) Rev: 1

Contact/Location: ELVIN DIAZ - UCAIRCAR