




OIL ANALYSIS REPORT

Sample Rating Trend

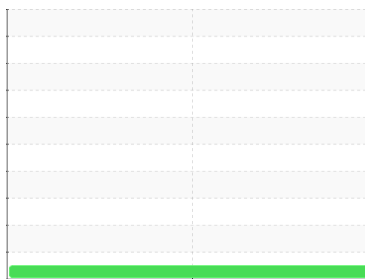

NORMAL



Machine Id
MARION 8200 DL3127 (S/N 23266)
 Component
Right Propel Gearbox
 Fluid
{not provided} (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			BRM001875	---	---
Sample Date	Client Info			15 May 2024	---	---
Machine Age	hrs	Client Info		217845	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed	Client Info			N/A	---	---
Sample Status				NORMAL	---	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.2	NEG	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	52	---	---
Chromium	ppm	ASTM D5185m	>10	<1	---	---
Nickel	ppm	ASTM D5185m	>10	<1	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m		4	---	---
Lead	ppm	ASTM D5185m		4	---	---
Copper	ppm	ASTM D5185m		4	---	---
Tin	ppm	ASTM D5185m		2	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
Cadmium	ppm	ASTM D5185m		0	---	---


ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		387	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		51	---	---
Manganese	ppm	ASTM D5185m		1	---	---
Magnesium	ppm	ASTM D5185m		1	---	---
Calcium	ppm	ASTM D5185m		17	---	---
Phosphorus	ppm	ASTM D5185m		381	---	---
Zinc	ppm	ASTM D5185m		41	---	---
Sulfur	ppm	ASTM D5185m		6605	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m		26	---	---
Sodium	ppm	ASTM D5185m		5	---	---
Potassium	ppm	ASTM D5185m	>20	400	---	---

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	MODER	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---
Precipitate	scalar	*Visual	NONE	NONE	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---
Free Water	scalar	*Visual		NEG	---	---



OIL ANALYSIS REPORT

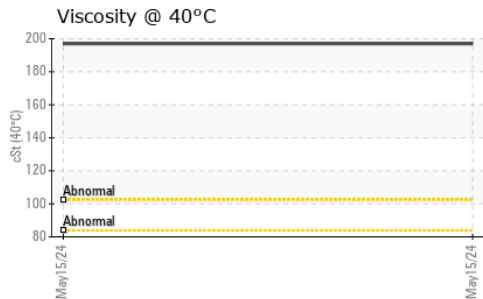




FLUID PROPERTIES

Property	Method	Limit/Base	Current	History1	History2
Visc @ 40°C	cSt	ASTM D445	197	---	---

SAMPLE IMAGES

Property	Method	Limit/Base	Current	History1	History2
Color			no image	no image	no image
Bottom			no image	no image	no image

GRAPHS

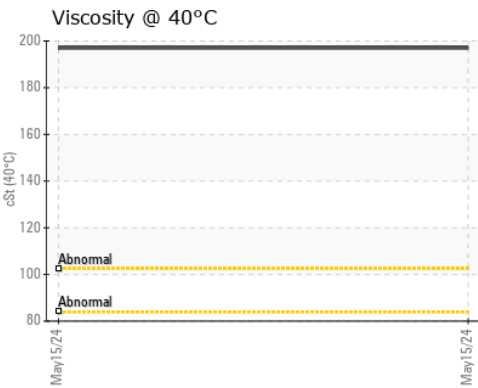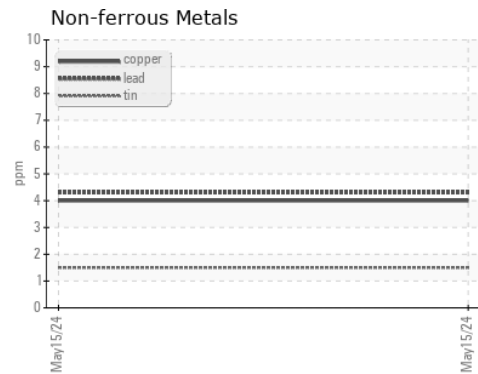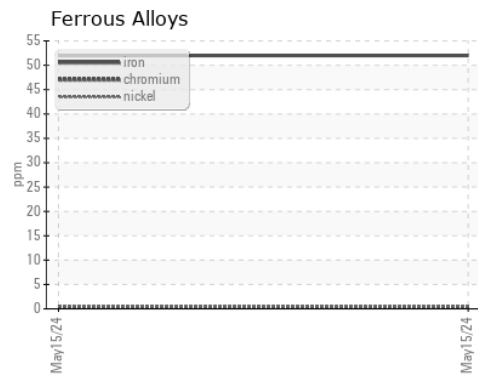

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : BRM001875
Lab Number : 06207009
Unique Number : 11074470
Test Package : IND 1

Received : 11 Jun 2024
Tested : 13 Jun 2024
Diagnosed : 13 Jun 2024 - Don Baldrige

WESTMORELAND ROSEBUD MINING
 PO BOX 99
 COLSTRIP, MT
 US 59323
 Contact: WALT SHAW
 WSHAW@WESTMORELAND.COM
 T: (406)748-5155
 F: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)