

## FUEL REPORT

Sample Rating Trend



#### Machine Id

# JOHN DEERE 370E 1DW370ETHDE651049

Diesel Fuel

Fluid No.2 DIESEL FUEL (ULTRALOW SULPHUR) (--- GAL)

#### DIAGNOSIS

#### Recommendation

No corrective action is recommended at this time.

#### Corrosion

All metal levels are normal indicating no corrosion in the system.

#### Contaminants

The water content is negligible. There is no indication of any contamination in the fuel.


### **Fuel Condition**

The condition of the fuel is acceptable for the time in service.


SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		JR0213433		
Sample Date		Client Info		10 Jun 2024		
Machine Age	hrs	Client Info		9015		
Sample Status				NORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	3.0	2.46		
SULFUR CONTER	١T	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m	10	0		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	<1		
Potassium	ppm	ASTM D5185m	<0.1	<1		
Water	%	ASTM D6304	<0.05	0.003		
ppm Water	ppm	ASTM D6304	<500	30		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	<1		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	0		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	5	method	limit/base	current	history1	history2
Color				•	no image	no image
Bottom					no image	no image



## **FUEL REPORT**

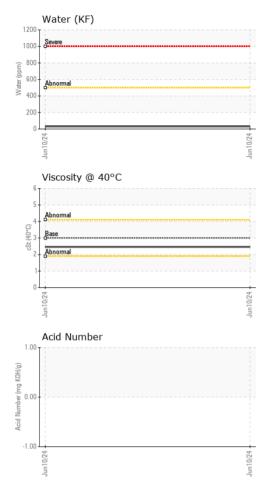

Pensky-Martens Flash Point (°C)



Contact/Location: NICK GALLAHER - JAMGRE

Page 2 of 2