


# **OIL ANALYSIS REPORT**

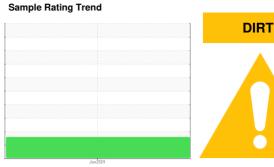

Machine Id 3201

**Front Differential** 

GEAR OIL SAE 75W90 (--- GAL)

## **DIAGNOSIS**

#### Recommendation

The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

### Contamination

Elemental level of silicon (Si) above normal indicating ingress of seal material.


#### **Fluid Condition**

The condition of the oil is acceptable for the time in service.

				Jun 2024		
CAMPLE INFORM	IATIONI		11 11 11		111	111
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0885729		
Sample Date		Client Info		08 Jun 2024		
Machine Age	hrs	Client Info		3286		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINATION	1	method	limit/base	current	history1	history2
Water		WC Method	>.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	120		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	3		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm		>100	2		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
	PPIII					
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	400	333		
Barium	ppm	ASTM D5185m	200	0		
Molybdenum	ppm	ASTM D5185m	12	<1		
Manganese	ppm	ASTM D5185m		2		
Magnesium	ppm	ASTM D5185m	12	<1		
Calcium	ppm	ASTM D5185m	150	9		
Phosphorus	ppm	ASTM D5185m	1650	1036		
Zinc	ppm	ASTM D5185m	125	2		
Sulfur	ppm	ASTM D5185m	22500	24201		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	<b>165</b>		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	3		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>.2	NEG		
Free Water	scalar	*Visual	7.6	NEG		



## **OIL ANALYSIS REPORT**

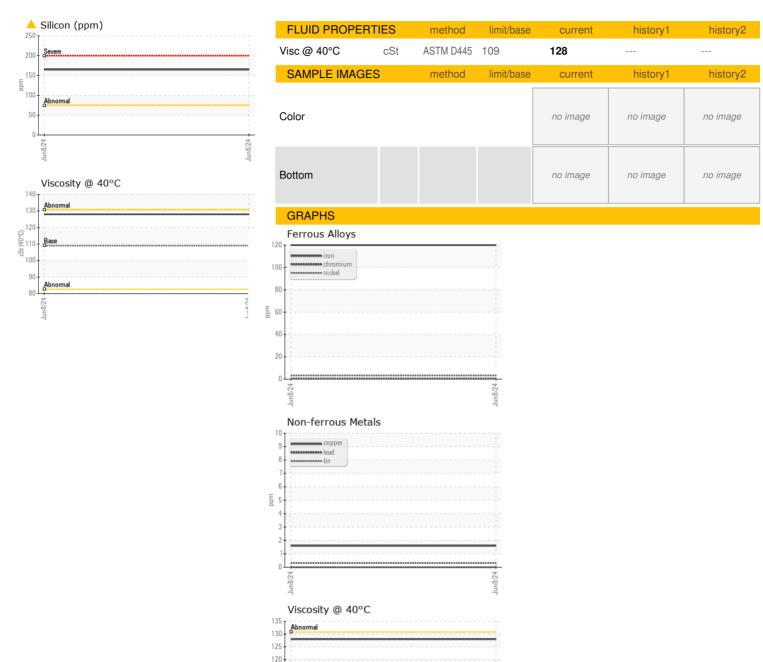





Laboratory Sample No.

: WC0885729 Lab Number : 06208195 Unique Number : 11075656

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received : 12 Jun 2024 Tested : 14 Jun 2024 Diagnosed : 14 Jun 2024 - Don Baldridge

**Apple Valley Waste - Baltimore District** 240 S KRESSON ST

BALTIMORE, MD US 21224 Contact: KEVIN HINSON

Test Package : CONST Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

khinson@goldmedal.net T:

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: