


OIL ANALYSIS REPORT

TE-PAO 46

GARDNER DENVER U53816 - ROCKVILLE ASPHALT

Component Compressor

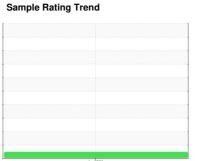



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06208835		
Sample Date		Client Info		04 Jun 2024		
Machine Age	hrs	Client Info		55832		
Oil Age	hrs	Client Info		2		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		230		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		1330		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.17		




OIL ANALYSIS REPORT

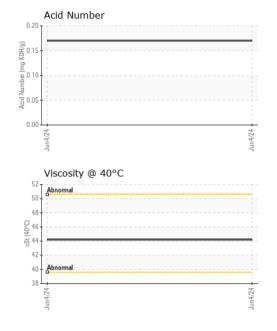


VISUAL		method	limit/base	current	history1	history2
White Metal	te Metal scalar *Visual NONE N		NONE			
Yellow Metal	scalar	*Visual	al NONE NON			
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	ance scalar *Visual NORML		NORML			
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual	/isual			
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		44.2		


SAMPLE IMAGES	metnoa	ilmit/base	current	nistory i	nistory2
Color				no image	no image
Bottom				no image	no image

GRAPHS

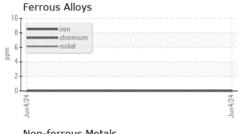

10	errous i	uis															
8-	copper i																
E 6 -	tin																
4																	
0		 	 	_	 	_	_	_	_	_	-	_	 _	_	_		-
Jun4/24																Jun 4/74	Julia

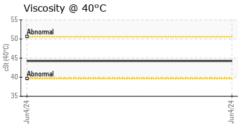

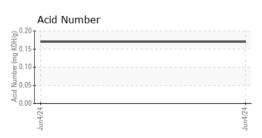





Laboratory Sample No.

: UCH06208835 Lab Number : 06208835

Unique Number : 11076296

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 13 Jun 2024 Tested : 14 Jun 2024

Diagnosed : 14 Jun 2024 - Wes Davis

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

TATE ENGINEERING

3921 Vero Road BALTIMORE, MD US 21227 Contact: JOSH PLITT josh.plitt@tate.com

T: (443)992-4413

Contact/Location: JOSH PLITT - UCTATBAL