



OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL



Machine Id
KALMAR 5605
 Component
Hydraulic System
 Fluid
DEXRON III (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DEXRON III. Please confirm.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	WC0941214	---	---
Sample Date	Client Info	03 Jun 2024	---	---
Machine Age	hrs Client Info	25284	---	---
Oil Age	hrs Client Info	0	---	---
Oil Changed	Client Info	N/A	---	---
Sample Status		NORMAL	---	---

CONTAMINATION

method	limit/base	current	history1	history2
Water	WC Method >0.1	NEG	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185m >20	18	---	---
Chromium	ppm ASTM D5185m >10	0	---	---
Nickel	ppm ASTM D5185m >10	0	---	---
Titanium	ppm ASTM D5185m	0	---	---
Silver	ppm ASTM D5185m	0	---	---
Aluminum	ppm ASTM D5185m >10	<1	---	---
Lead	ppm ASTM D5185m >10	6	---	---
Copper	ppm ASTM D5185m >75	1	---	---
Tin	ppm ASTM D5185m >10	<1	---	---
Vanadium	ppm ASTM D5185m	0	---	---
Cadmium	ppm ASTM D5185m	0	---	---

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185m	58	---	---
Barium	ppm ASTM D5185m	0	---	---
Molybdenum	ppm ASTM D5185m	0	---	---
Manganese	ppm ASTM D5185m	<1	---	---
Magnesium	ppm ASTM D5185m	6	---	---
Calcium	ppm ASTM D5185m	51	---	---
Phosphorus	ppm ASTM D5185m	204	---	---
Zinc	ppm ASTM D5185m	150	---	---
Sulfur	ppm ASTM D5185m	1812	---	---

CONTAMINANTS


method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185m >20	3	---	---
Sodium	ppm ASTM D5185m	3	---	---
Potassium	ppm ASTM D5185m >20	1	---	---

VISUAL

method	limit/base	current	history1	history2
White Metal	scalar *Visual NONE	NONE	---	---
Yellow Metal	scalar *Visual NONE	NONE	---	---
Precipitate	scalar *Visual NONE	NONE	---	---
Silt	scalar *Visual NONE	NONE	---	---
Debris	scalar *Visual NONE	NONE	---	---
Sand/Dirt	scalar *Visual NONE	NONE	---	---
Appearance	scalar *Visual NORML	NORML	---	---
Odor	scalar *Visual NORML	NORML	---	---
Emulsified Water	scalar *Visual >0.1	NEG	---	---
Free Water	scalar *Visual	NEG	---	---











OIL ANALYSIS REPORT

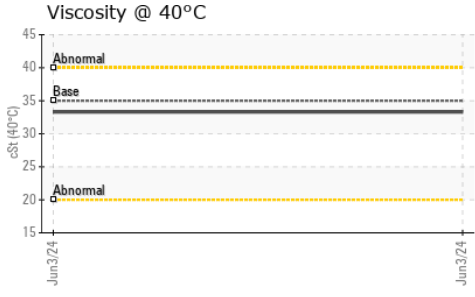

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D445	35.0	33.3	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS

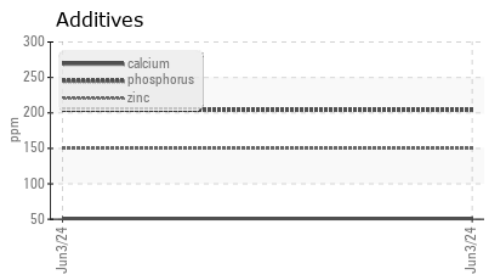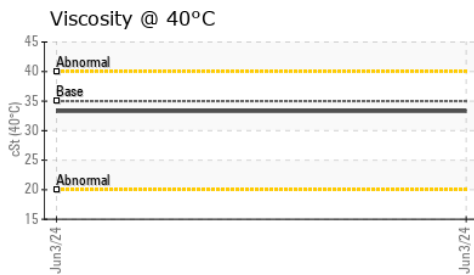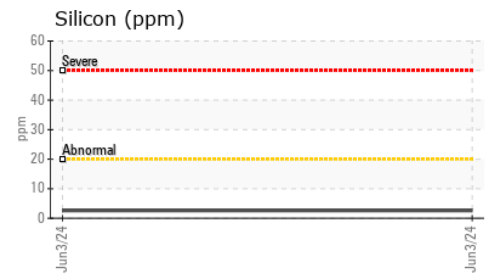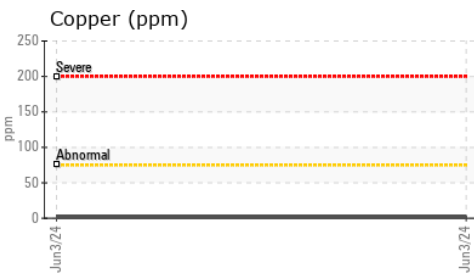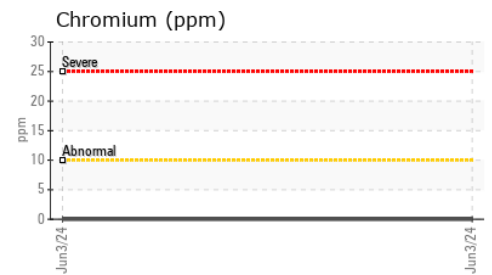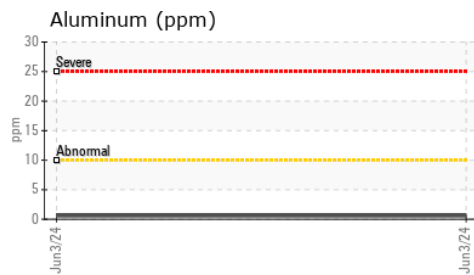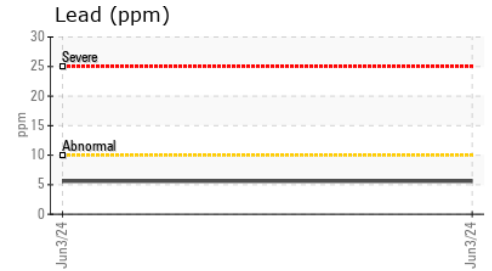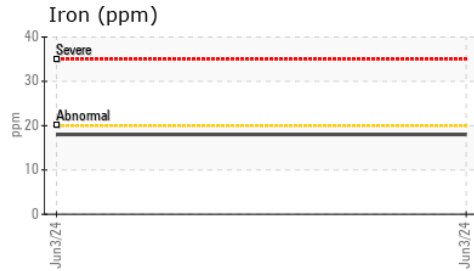

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0941214 **Received** : 13 Jun 2024
Lab Number : 06209068 **Tested** : 14 Jun 2024
Unique Number : 11076529 **Diagnosed** : 14 Jun 2024 - Wes Davis
Test Package : MOB 1

INTERSTATE WASTE-NEWARK
 110 EVERGREEN AVE, BAY 3
 NEWARK, NJ
 US 07114
 Contact: Robert Witynski
 RWitynski@interstatewaste.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)