




OIL ANALYSIS REPORT

Area
VISION 8K
 Machine Id
HODGE 2201010416 - FUN SPOT
 Component
Compressor

Sample Rating Trend

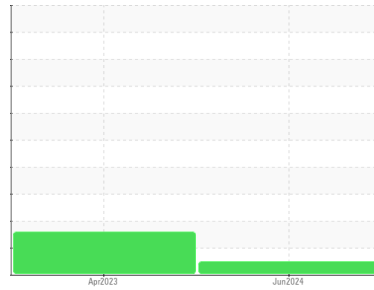

DIAGNOSIS

Recommendation
 Resample at the next service interval to monitor.

Wear
 All component wear rates are normal.

Contamination
 There is no indication of any contamination in the oil.

Fluid Condition
 The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		UHC0001089	UHC0000712	---
Sample Date	Client Info		11 Jun 2024	06 Apr 2023	---
Machine Age	hrs	Client Info	3796	220	---
Oil Age	hrs	Client Info	1190	220	---
Oil Changed	Client Info		Changed	Changed	---
Sample Status			NORMAL	ABNORMAL	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	NEG	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	0	2	---
Chromium	ppm	ASTM D5185m >10	0	0	---
Nickel	ppm	ASTM D5185m	0	0	---
Titanium	ppm	ASTM D5185m	<1	0	---
Silver	ppm	ASTM D5185m	0	0	---
Aluminum	ppm	ASTM D5185m >25	0	0	---
Lead	ppm	ASTM D5185m >25	0	0	---
Copper	ppm	ASTM D5185m >50	<1	0	---
Tin	ppm	ASTM D5185m >15	0	0	---
Vanadium	ppm	ASTM D5185m	<1	0	---
Cadmium	ppm	ASTM D5185m	0	0	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0.3	0	0	---
Barium	ppm	ASTM D5185m 0.3	0	0	---
Molybdenum	ppm	ASTM D5185m 0	0	0	---
Manganese	ppm	ASTM D5185m 0.9	<1	<1	---
Magnesium	ppm	ASTM D5185m 0.2	0	2	---
Calcium	ppm	ASTM D5185m 0.1	0	1	---
Phosphorus	ppm	ASTM D5185m 429	98	16	---
Zinc	ppm	ASTM D5185m 0.3	34	21	---
Sulfur	ppm	ASTM D5185m 1336	195	52	---

CONTAMINANTS



	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	4	5	---
Sodium	ppm	ASTM D5185m	1	0	---
Potassium	ppm	ASTM D5185m >20	0	<1	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 0.622	0.28	0.09	---




OIL ANALYSIS REPORT

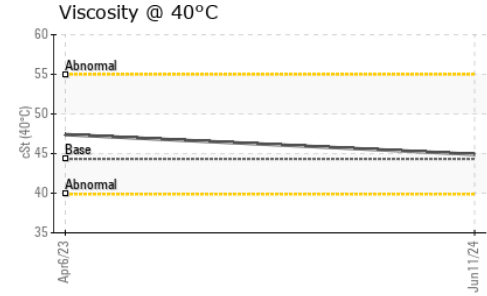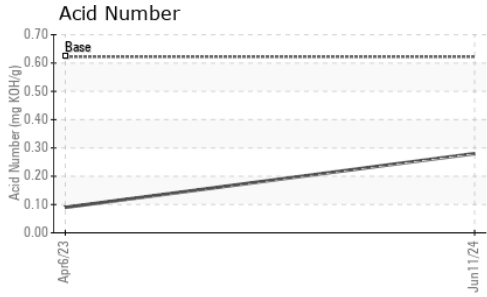





VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	*Visual	NONE	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	LIGHT	---
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.1	NEG	▲ 0.2%	---
Free Water	scalar	*Visual		NEG	▲ 10.0	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D445	44.32	44.9	47.4	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

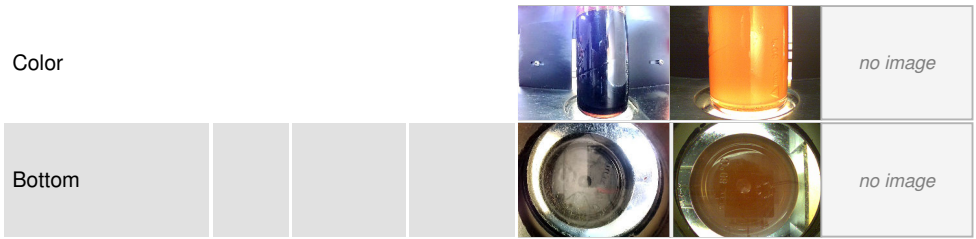

GRAPHS

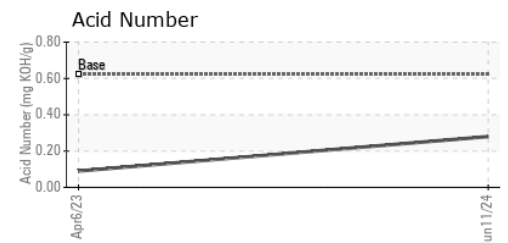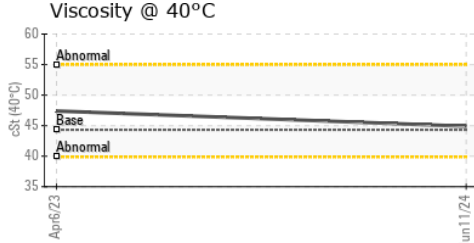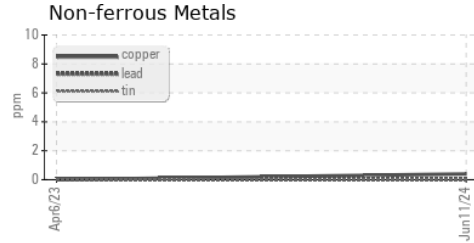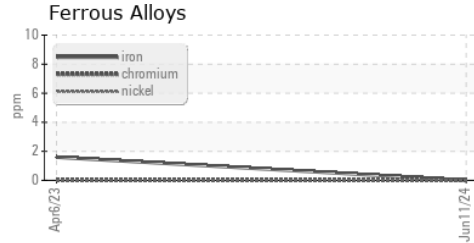

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : UHC0001089 **Received** : 17 Jun 2024
Lab Number : **06211829** **Tested** : 18 Jun 2024
Unique Number : 11084693 **Diagnosed** : 19 Jun 2024 - Don Baldrige
Test Package : IND 2

ATLANTA AIR COMPRESSOR
 123 MERCHANTS PARK DR
 HOSCHTON, GA 30548
 Contact: Derik Bray
 Derik@atlantaaircompressor.com
 T: (470)252-9952
 F: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)