


OIL ANALYSIS REPORT

ROTO XTEND [1383997]

ATLAS COPCO CAI616501 - MICHIGAN MILK

Component Compressor

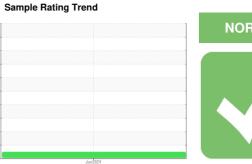



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06215860		
Sample Date		Client Info		14 Jun 2024		
Machine Age	hrs	Client Info		76458		
Oil Age	hrs	Client Info		5851		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	0		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		40		
Zinc	ppm	ASTM D5185m		90		
Sulfur	ppm	ASTM D5185m		97		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	0		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	3		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.26		





OIL ANALYSIS REPORT

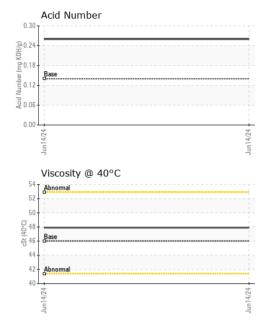

VISUAL		method	limit/base	current	history1	history2		
White Metal	scalar	*Visual	NONE	NONE				
Yellow Metal	scalar	*Visual	NONE	NONE				
Precipitate	scalar	*Visual	NONE	NONE				
Silt	scalar	*Visual	NONE	NONE				
Debris	scalar	*Visual	NONE	MODER				
Sand/Dirt	scalar	*Visual	NONE	NONE				
Appearance	scalar	*Visual	NORML	NORML				
Odor	scalar	*Visual	NORML	NORML				
Emulsified Water	scalar	*Visual	>0.1	NEG				
Free Water	scalar	*Visual		NEG				
FLUID PROPERTIES		method	limit/base	current	history1	history2		
Visc @ 40°C	cSt	ASTM D445	46	47.9				
SAMPLE IMAGES		method	limit/base	current	history1	history2		
Color					no image	no image		
Bottom					no image	no image		
GRAPHS								
Correus Alleys								

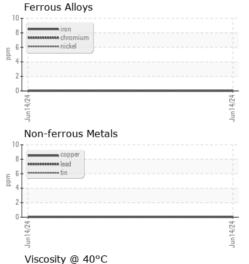

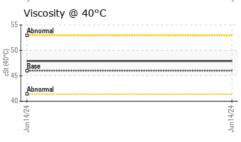

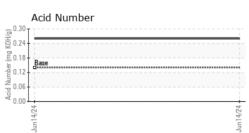





Certificate 12367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06215860 Unique Number : 11088724

Test Package : IND 2

: UCH06215860

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Tested Diagnosed

Received : 20 Jun 2024 : 21 Jun 2024

: 22 Jun 2024 - Don Baldridge

AIR TECHNOLOGIES INC (GR) 160 84TH STREET SW SUITE 1 BYRON CENTER, MI US 49315

Contact: STEPHANIE CLAYPOOL stephanie.claypool@aircompressors.com

F: (616)281-6737

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: STEPHANIE CLAYPOOL - UCAIRBYR

T: