


OIL ANALYSIS REPORT



Area KANSAS/44 Machine Id 38.87 [KANSAS^44]

Rear Left Final Drive

MOBIL MOBILTRANS HD 50 (--- GAL)

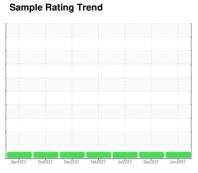



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0908905	WC0832357	WC0781240
Sample Date		Client Info		05 Jun 2024	05 Sep 2023	06 Jul 2023
Machine Age	hrs	Client Info		2194	1844	1532
Oil Age	hrs	Client Info		716	522	522
Oil Changed		Client Info		Changed	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>800	139	105	117
Chromium	ppm	ASTM D5185m	>10	3	2	3
Nickel	ppm	ASTM D5185m	>5	<1	0	<1
Titanium	ppm	ASTM D5185m	>15	<1	<1	<1
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>75	2	2	2
Lead	ppm	ASTM D5185m	>10	<1	<1	1
Copper	ppm	ASTM D5185m	>75	9	7	6
Tin	ppm	ASTM D5185m	>8	0	<1	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		2	<1	0
Barium	ppm	ASTM D5185m		1	<1	4
Molybdenum	ppm	ASTM D5185m		0	0	<1
Manganese	ppm	ASTM D5185m		3	3	3
Magnesium	ppm	ASTM D5185m		11	13	11
Calcium	ppm	ASTM D5185m		3149	3078	3267
Phosphorus	ppm	ASTM D5185m		1163	1036	1120
Zinc	ppm	ASTM D5185m		1369	1267	1336
Sulfur	ppm	ASTM D5185m		9138	10319	10536
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>400	12	12	12
	ppm	ASTM D5185m		3	4	0
	ppm	ASTM D5185m	>20	7	5	8
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	LIGHT
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
:-OE-EE\ Dove 1				C	la realist and Dov. MAAA	VNE HUDDADD





OIL ANALYSIS REPORT

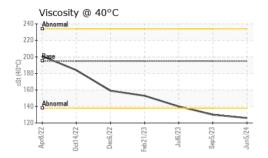

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	195	126	130	140
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color				no image	no image	no image
Bottom				no image	no image	no image
ODADUO						

GRAPHS

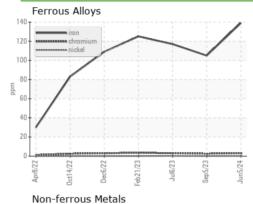

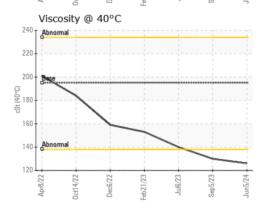





Certificate 12367

Sample No. : WC0908905 Lab Number : 06216112 Unique Number : 11088976 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested**

: 20 Jun 2024 : 21 Jun 2024 : 21 Jun 2024 - Wes Davis Diagnosed

SHERWOOD CONSTRUCTION CO INC 3219 WEST MAY ST

WICHITA, KS US 67213 Contact: DOUG KING doug.king@sherwood.net

T: (316)617-3161

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: x: