




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Area
[W02008430]
 Machine Id
VOLVO L70H 622409
 Component
Front Axle
 Fluid
{not provided} (--- GAL)

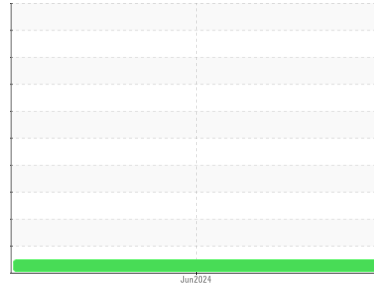

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample. (Customer Sample Comment: W02008430)

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		ML0002484	---	---
Sample Date	Client Info		19 Jun 2024	---	---
Machine Age	hrs	Client Info	12321	---	---
Oil Age	hrs	Client Info	12321	---	---
Oil Changed		Client Info	N/A	---	---
Sample Status			NORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >500	63	---	---
Chromium	ppm	ASTM D5185m >20	2	---	---
Nickel	ppm	ASTM D5185m >10	0	---	---
Titanium	ppm	ASTM D5185m	<1	---	---
Silver	ppm	ASTM D5185m	0	---	---
Aluminum	ppm	ASTM D5185m >30	4	---	---
Lead	ppm	ASTM D5185m >50	0	---	---
Copper	ppm	ASTM D5185m >120	2	---	---
Tin	ppm	ASTM D5185m >20	<1	---	---
Vanadium	ppm	ASTM D5185m	0	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	119	---	---
Barium	ppm	ASTM D5185m	0	---	---
Molybdenum	ppm	ASTM D5185m	<1	---	---
Manganese	ppm	ASTM D5185m	4	---	---
Magnesium	ppm	ASTM D5185m	19	---	---
Calcium	ppm	ASTM D5185m	3842	---	---
Phosphorus	ppm	ASTM D5185m	1350	---	---
Zinc	ppm	ASTM D5185m	1559	---	---
Sulfur	ppm	ASTM D5185m	9489	---	---


CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >50	22	---	---
Sodium	ppm	ASTM D5185m	6	---	---
Potassium	ppm	ASTM D5185m >20	3	---	---

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	NONE	---	---
Yellow Metal	scalar	*Visual NONE	NONE	---	---
Precipitate	scalar	*Visual NONE	NONE	---	---
Silt	scalar	*Visual NONE	NONE	---	---
Debris	scalar	*Visual NONE	NONE	---	---
Sand/Dirt	scalar	*Visual NONE	NONE	---	---
Appearance	scalar	*Visual NORML	NORML	---	---
Odor	scalar	*Visual NORML	NORML	---	---
Emulsified Water	scalar	*Visual >0.2	NEG	---	---
Free Water	scalar	*Visual	NEG	---	---




OIL ANALYSIS REPORT

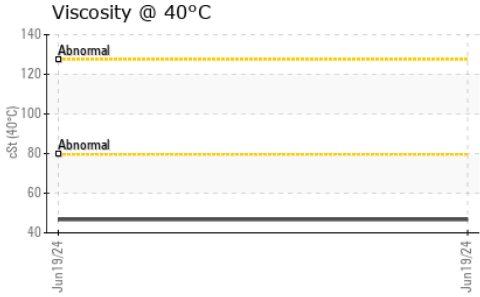

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46.7	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image

GRAPHS

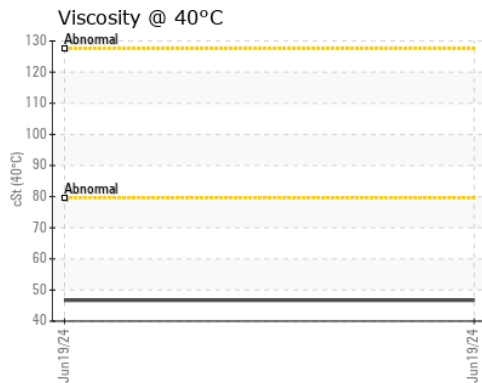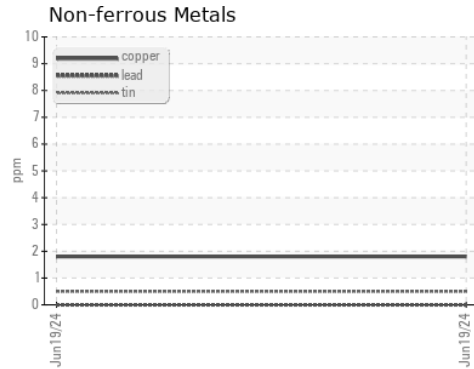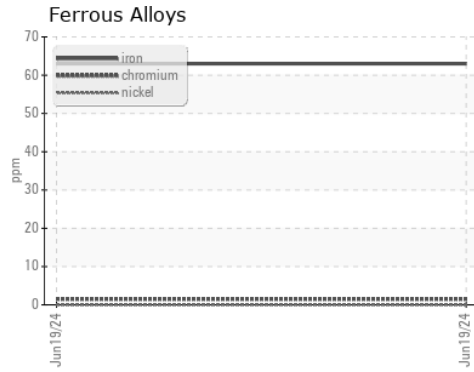

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : ML0002484 **Received** : 20 Jun 2024
Lab Number : 06216375 **Tested** : 21 Jun 2024
Unique Number : 11089239 **Diagnosed** : 23 Jun 2024 - Don Baldrige
Test Package : CONST

WILLIAM HAZEL
 PO BOX 600
 CHANTILLY, VA
 US 20153
 Contact: SERVICE MANAGER
 jimmy_elswick@wahazel.com
 T: (703)378-8300
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)