






COLORADO/443/EG - EXCAVATOR 20.306L [COLORADO^443^EG - EXCAVATOR]

Right Final Drive

MOBIL MOBILTRANS HD 50 (2 GAL)

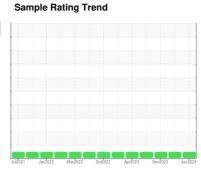



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

1D 50 (2 GAL)						
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0928693	WC0884038	WC0859598
Sample Date		Client Info		18 Jun 2024	24 Jan 2024	21 Nov 2023
Machine Age	hrs	Client Info		12040	5735	5631
Oil Age	hrs	Client Info		6305	0	5631
Oil Changed		Client Info		Not Changd	Changed	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	J	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>800	35	42	43
Chromium	ppm	ASTM D5185m	>10	0	1	<1
Nickel	ppm	ASTM D5185m	>5	0	1	0
Titanium	ppm	ASTM D5185m	>15	<1	<1	<1
Silver	ppm	ASTM D5185m	>2	0	<1	0
Aluminum	ppm	ASTM D5185m	>75	3	3	2
Lead	ppm	ASTM D5185m	>10	0	<1	0
Copper	ppm	ASTM D5185m	>75	0	<1	<1
Tin	ppm	ASTM D5185m	>8	0	1	0
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		0	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		3	1	2
Barium	ppm	ASTM D5185m		0	0	2
Molybdenum	ppm	ASTM D5185m		0	2	1
Manganese	ppm	ASTM D5185m		<1	2	<1
Magnesium	ppm	ASTM D5185m		24	21	21
Calcium	ppm	ASTM D5185m		3257	2928	3195
Phosphorus	ppm	ASTM D5185m		1161	1038	1079
Zinc	ppm	ASTM D5185m		1374	1306	1335
Sulfur	ppm	ASTM D5185m		16520	12207	18776
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>400	17	10	11
Sodium	ppm	ASTM D5185m		4	0	0
Potassium	ppm	ASTM D5185m	>20	3	3	3
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG





OIL ANALYSIS REPORT

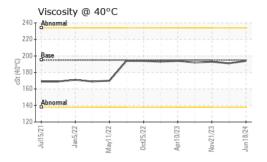


Visc @ 40°C				current	history1	history2
=	cSt	ASTM D445	195	194	191	193
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color				no image	no image	no image
Bottom				no image	no image	no image

GRAPHS

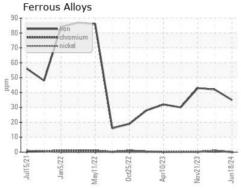

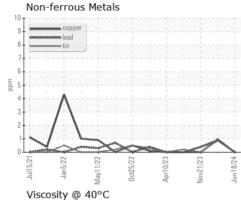

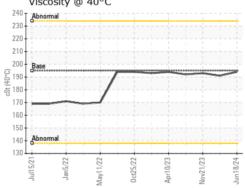



Certificate 12367

Laboratory Sample No. Lab Number : 06217189

: WC0928693

Unique Number : 11090053 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Jun 2024

Tested : 24 Jun 2024 : 24 Jun 2024 - Wes Davis Diagnosed

SHERWOOD CONSTRUCTION CO INC

3219 WEST MAY ST WICHITA, KS US 67213

Contact: DOUG KING doug.king@sherwood.net T: (316)617-3161

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: SHEWIC [WUSCAR] 06217189 (Generated: 06/24/2024 15:02:30) Rev: 1

Submitted By: BRANDEN JAQUIAS

F: x: