


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

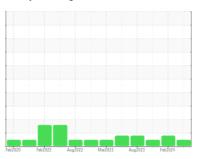

SYLV_U1 SYLV_U1_M1

Drive End Bearing

SHELL TELLUS 32 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0032733	RP0036975	RP0027362
Sample Date		Client Info		12 Jun 2024	16 Feb 2024	01 Nov 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	ABNORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	2	2	<1
Chromium	ppm	ASTM D5185m	>20	<1	<1	<1
Nickel	ppm	ASTM D5185m	>20	<1	<1	<1
Titanium	ppm	ASTM D5185m		<1	<1	<1
Silver	ppm	ASTM D5185m		<1	<1	<1
Aluminum	ppm	ASTM D5185m	>20	3	<1	2
Lead	ppm	ASTM D5185m	>20	1	<1	<1
Copper	ppm	ASTM D5185m	>20	4	4	2
Tin	ppm	ASTM D5185m	>20	17	<u>^</u> 23	9
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		<1	<1	<1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		1	5	0
Molybdenum	ppm	ASTM D5185m		<1	<1	<1
Manganese	ppm	ASTM D5185m		<1	<1	0
Magnesium	ppm	ASTM D5185m	11	67	60	70
Calcium	ppm	ASTM D5185m	35	9	12	13
Phosphorus	ppm	ASTM D5185m	259	306	226	286
Zinc	ppm	ASTM D5185m	277	357	322	350
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	5	3	3
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	1	<1	<1
Water	%	ASTM D6304	>0.05	0.001	0.001	0.005
ppm Water	ppm	ASTM D6304	>500	3	2	50.6
FLUID DEGRAD	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.32	0.38	0.36	0.32
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	Suppositted B	y: Nigotas Pucci




OIL ANALYSIS REPORT

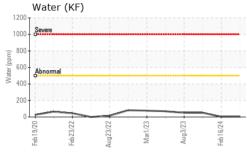


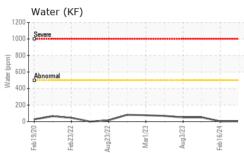


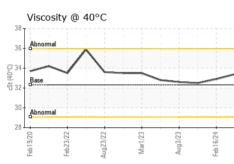




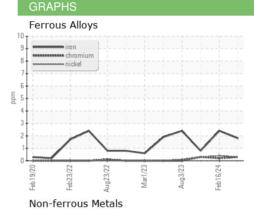

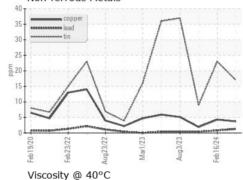

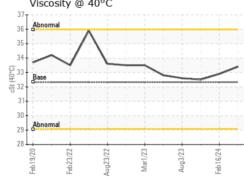

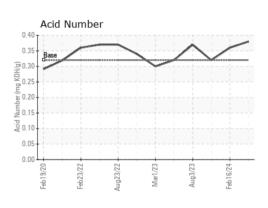





Certificate 12367

Laboratory Sample No.

: RP0032733 Lab Number : 06217380 Unique Number : 11090244

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Jun 2024

Tested : 25 Jun 2024 Diagnosed

: 25 Jun 2024 - Don Baldridge

SYLVANIA, PA US 16945 Contact: JERRY HIGGINS

ENERGY TRANSFER - SYLVANIA

Test Package : IND 2 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) T: (610)858-3838 F:

ROUTE 6