


# **OIL ANALYSIS REPORT**

Area CIP-100 Machine Id **D214649 - CITY WHOLESALE** Component Compressor



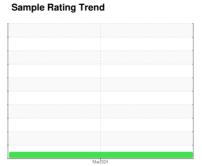

#### Recommendation

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

Moderate concentration of visible dirt/debris present in the oil.


### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCP06218381		
Sample Date		Client Info		14 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	9		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	4		
Lead	ppm	ASTM D5185m	>25	<1		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		7		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		11		
Zinc	ppm	ASTM D5185m		3		
Sulfur	ppm	ASTM D5185m		1885		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	22		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	3		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.091		




## **OIL ANALYSIS REPORT**

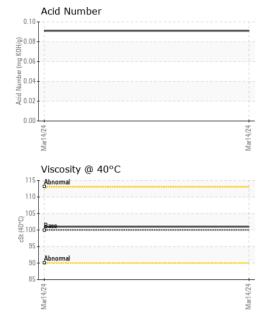



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	MODER		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	100	101		

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image
GRAPHS					

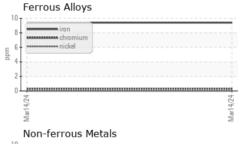

10 <sub>T</sub> -	von-rerrous metais
8-	copper
6-	energeneene tin
4+	
2-	
0 L	4 C
14.74 M	
	/iscosity @ 40°C

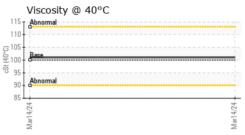

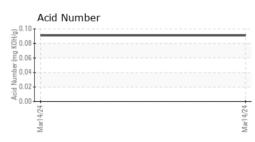





Certificate 12367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06218381

: UCP06218381 Unique Number : 11096578 Test Package : IND 2

Received : 24 Jun 2024 **Tested** : 25 Jun 2024

Diagnosed : 26 Jun 2024 - Don Baldridge **PATTONS INC - BIRMINGHAM** 

20 MONROE DR PELHAM, AL US 35124

Contact: MARK FLOYD mark.floyd@pattonsinc.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (205)780-4508

Report Id: UCPATBIR [WUSCAR] 06218381 (Generated: 06/29/2024 21:15:06) Rev: 1

Contact/Location: MARK FLOYD - UCPATBIR