


OIL ANALYSIS REPORT

Area S-460 **KAESER 1093 - BELLE TIRE** Component Compressor



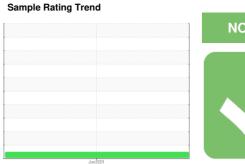

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UDI0000384		
Sample Date		Client Info		18 Jun 2024		
Machine Age	hrs	Client Info		2419		
Oil Age	hrs	Client Info		2419		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	<1		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	17		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	90	3		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		0		
Zinc	ppm	ASTM D5185m		26		
Sulfur	ppm	ASTM D5185m		21792		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.24		




OIL ANALYSIS REPORT

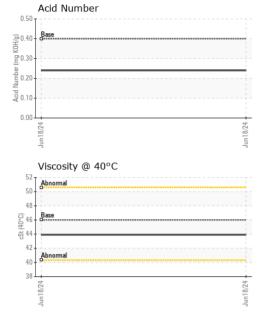



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.05	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	43.9		
SAMPLE IMAGES	3	method	limit/base	current	history1	history2

CHIVIT LE IIVITALE			
Color		no image	no image
Bottom		no image	no image
GRAPHS			

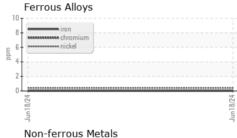

Non-ferrous Metals	
20	
15 - Landanana lead	
E 10	
5	
0 —	_
Jun 18/24	701110C
Viit @ 400C	

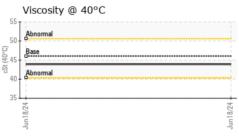

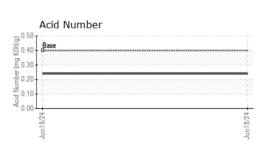





Certificate 12367

Laboratory Sample No.

: UDI0000384 Lab Number : 06219824 Unique Number : 11098021

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 25 Jun 2024

Tested : 26 Jun 2024 : 26 Jun 2024 - Wes Davis Diagnosed

DELTA INDUSTRIES - DOWNERS GROVE

2201 CURTISS STREET DOWNERS GROVE, IL US 60515

Contact: MICHAEL FERRIS

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (630)960-3931