

OIL ANALYSIS REPORT

MINING

ME-600 JOHN DEERE 944K 1DW944KSCKF702606

Front Right Final Drive

SHELL Spirax S4 CX 30 (--- GAL)

Sample Rating Trend



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.


		L		Jul2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0944242		
Sample Date		Client Info		01 Jul 2024		
Machine Age	hrs	Client Info		14541		
Oil Age	hrs	Client Info		0		
Oil Changed	1110	Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.075	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>750	12		
Chromium	ppm	ASTM D5185m	>9	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>40	<1		
Lead	ppm	ASTM D5185m	>15	0		
Copper	ppm	ASTM D5185m		15		
Tin		ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m	>10	0		
	ppm					
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		8		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		76		
Calcium	ppm	ASTM D5185m		3273		
Phosphorus	ppm	ASTM D5185m		1004		
Zinc	ppm	ASTM D5185m		1105		
Sulfur	ppm	ASTM D5185m		4217		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	6		
Sodium	ppm	ASTM D5185m	>51	3		
Potassium	ppm	ASTM D5185m	>20	0		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
			NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
	scalar scalar	*Visual	NONE	NONE		
Precipitate						
Precipitate Silt	scalar	*Visual	NONE	NONE		
Precipitate Silt Debris	scalar scalar	*Visual *Visual	NONE NONE	NONE NONE		
Precipitate Silt Debris Sand/Dirt	scalar scalar scalar	*Visual *Visual *Visual	NONE NONE	NONE NONE NONE		
Precipitate Silt Debris Sand/Dirt Appearance	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NONE	NONE NONE NONE		
Yellow Metal Precipitate Silt Debris Sand/Dirt Appearance Odor Emulsified Water	scalar scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual *Visual	NONE NONE NONE NONE NORML NORML	NONE NONE NONE NONE NORML		
Precipitate Silt Debris Sand/Dirt Appearance Odor	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NONE NORML	NONE NONE NONE NONE NORML		




OIL ANALYSIS REPORT

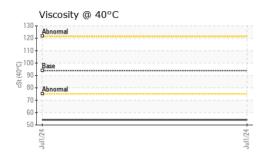

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	93.9	54.2		
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color				no image	no image	no image
Bottom				no image	no image	no image

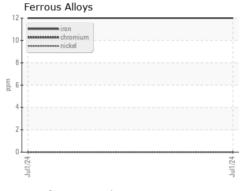

Non-ferrous Metals

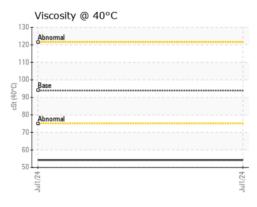



Laboratory

Sample No. : WC0944242 Lab Number : 06236581 Unique Number : 11125415

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 15 Jul 2024 Tested

: 16 Jul 2024 : 17 Jul 2024 - Sean Felton Diagnosed

1446 DEVILS BACKBONE ROAD OREGON, IL US 61061-0156 Contact: Brian Bunnell

brian.bunnell@coviacorp.com T: (815)677-8700

COVIA - OREGON - 004

Test Package : CONST Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)