

OIL ANALYSIS REPORT

ROTO XTEND FG [419049] ATLAS COPCO API335005 - AMERICAN WATER

Component Compressor





DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06236984		
Sample Date		Client Info		11 Jun 2024		
Machine Age	hrs	Client Info		9414		
Oil Age	hrs	Client Info		10		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		<1		
Aluminum	ppm	ASTM D5185m	>15	2		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	2		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		559		
Zinc	ppm	ASTM D5185m		45		
Sulfur	ppm	ASTM D5185m		1325		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.27		



OIL ANALYSIS REPORT

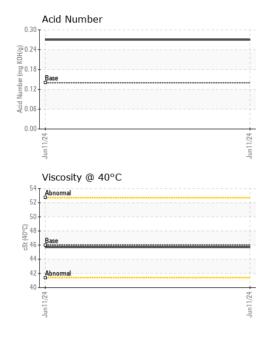


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	LIGHT		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	45.7		
SAMPLE IMAGES		method	limit/base	current	history1	history2


GRAPHS


Bottom

Color

Ferrous Alloys Non-ferrous Metals

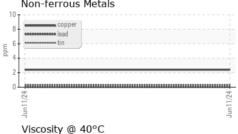

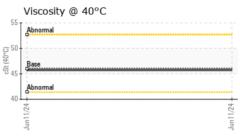

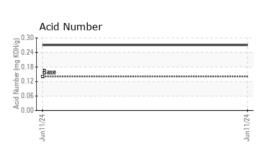

no image

no image

no image

no image





Laboratory

Sample No. Lab Number : 06236984

: UCH06236984 Unique Number : 11125818

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received : 15 Jul 2024 Tested Diagnosed

: 17 Jul 2024 : 17 Jul 2024 - Don Baldridge

AIRMATIC COMPRESSOR SYSTEMS

700 WASHINGTON AVE CARLSTADT, NJ US 07072

Contact: ELVIN DIAZ ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T: (800)864-7621 F: (201)342-6241

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: ELVIN DIAZ - UCAIRCAR