


## **OIL ANALYSIS REPORT**

# **SMART OIL 6000 HERTZ NOT GIVEN UHK0000528**

Component Compressor

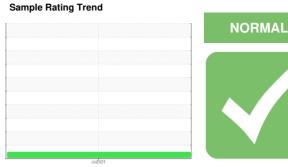

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jul2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UHK0000528		
Sample Date		Client Info		03 Jul 2024		
Machine Age	hrs	Client Info		10465		
Oil Age	hrs	Client Info		3361		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m	20	0		
Phosphorus	ppm	ASTM D5185m		567		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		1188		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.18		



## **OIL ANALYSIS REPORT**

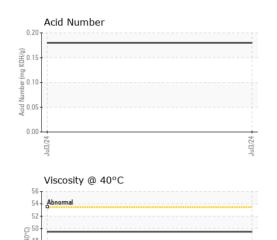


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TIES	method	limit/base	current	history1	history2

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

49.5

## **GRAPHS**


Visc @ 40°C

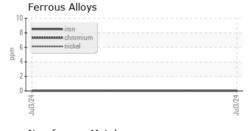


cSt

ASTM D445 46

	10_	Non-ferrous Metals
	8-	copper
mdd	6-	energeneere (I)
П	4 -	<u> </u>
	٦٥	Jui3/24

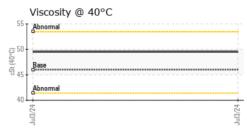

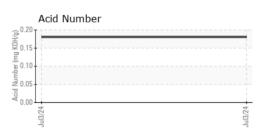





Certificate 12367

Laboratory

Sample No. : UHK0000528 Lab Number : 06237878

Test Package : IND 2

Unique Number : 11126712

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

: 16 Jul 2024 Tested : 17 Jul 2024 Diagnosed : 17 Jul 2024 - Wes Davis

ATLANTA AIR COMPRESSOR - HERTZ 123 MERCHANTS PARK DR HOSCHTON, GA

US 30548 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCATLHER [WUSCAR] 06237878 (Generated: 07/17/2024 12:01:19) Rev: 1

Contact/Location: Service Manager - UCATLHER

T:

F: