


OIL ANALYSIS REPORT

SMART OIL 6000 HERTZ VD020501 - ROECHLING

Component Compressor



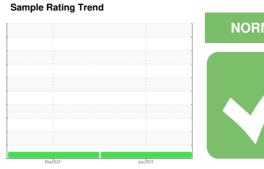

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UHK06237908	UHK06185100	
Sample Date		Client Info		13 Jun 2024	18 Mar 2024	
Machine Age	hrs	Client Info		2254	1288	
Oil Age	hrs	Client Info		1000	1288	
Oil Changed		Client Info		Not Changd	Not Changd	
Sample Status				NORMAL	NORMAL	
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1	<1	
Chromium	ppm	ASTM D5185m	>10	0	<1	
Nickel	ppm	ASTM D5185m		0	0	
Titanium	ppm	ASTM D5185m		0	<1	
Silver	ppm	ASTM D5185m		0	<1	
Aluminum	ppm	ASTM D5185m	>25	3	1	
Lead	ppm	ASTM D5185m	>25	0	<1	
Copper	ppm	ASTM D5185m	>50	0	<1	
Tin	ppm	ASTM D5185m	>15	0	<1	
Vanadium	ppm	ASTM D5185m		0	<1	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		<1	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m		0	<1	
Calcium	ppm	ASTM D5185m	20	0	0	
Phosphorus	ppm	ASTM D5185m		70	69	
Zinc	ppm	ASTM D5185m		7	0	
Sulfur	ppm	ASTM D5185m		322	297	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	2	
Sodium	ppm	ASTM D5185m		2	0	
Potassium	ppm	ASTM D5185m	>20	0	<1	
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.10	0.09	



OIL ANALYSIS REPORT

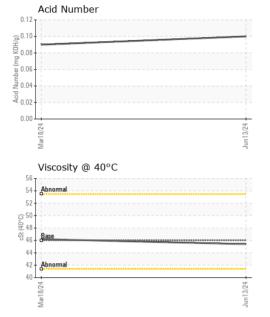



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	NONE	NONE	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	
Free Water	scalar	*Visual		NEG	NEG	
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	45.4	46.2	
SAMPLE IMAGES		method	limit/base	current	history1	history2


GRAPHS

Color

Bottom

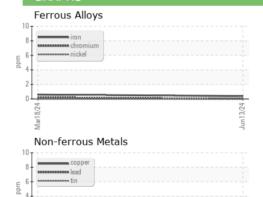

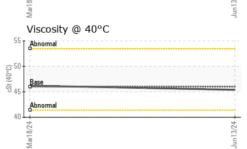

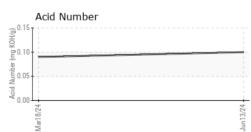





Certificate 12367

Laboratory

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : UHK06237908 Lab Number : 06237908

Unique Number : 11126742

Received : 16 Jul 2024 Tested Diagnosed

: 17 Jul 2024

: 18 Jul 2024 - Sean Felton

ATLANTA AIR COMPRESSOR - HERTZ 123 MERCHANTS PARK DR

HOSCHTON, GA US 30548

T:

F:

no image

no image

Contact: Service Manager

Test Package : IND 2 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: Service Manager - UCATLHER