


OIL ANALYSIS REPORT

SMART OIL **HERTZ VD032002**

Component Compressor



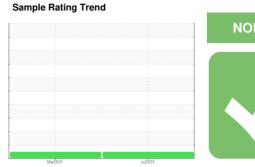

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UHK06237909	UHK06123832	
Sample Date		Client Info		09 Jul 2024	07 Mar 2024	
Machine Age	hrs	Client Info		4213	1639	
Oil Age	hrs	Client Info		0	1639	
Oil Changed		Client Info		Not Changd	Not Changd	
Sample Status				NORMAL	NORMAL	
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	4	4	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m		0	<1	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>25	6	8	
Lead	ppm	ASTM D5185m	>25	0	0	
Copper	ppm	ASTM D5185m	>50	<1	0	
Tin	ppm	ASTM D5185m	>15	0	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		<1	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		<1	0	
Magnesium	ppm	ASTM D5185m		<1	0	
Calcium	ppm	ASTM D5185m	20	0	0	
Phosphorus	ppm	ASTM D5185m		40	53	
Zinc	ppm	ASTM D5185m		3	10	
Sulfur	ppm	ASTM D5185m		329	486	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	4	2	
Sodium	ppm	ASTM D5185m		3	<1	
Potassium	ppm	ASTM D5185m	>20	<1	0	
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.06	0.203	



42

OIL ANALYSIS REPORT

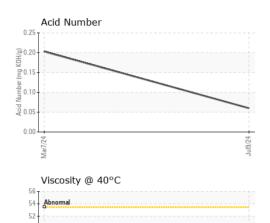


VISUAL		method				history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	LIGHT	MODER	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	
Free Water	scalar	*Visual		NEG	NEG	
FLUID PROPER	ΓIES	method	limit/base	current	history1	history2


I LOID I HOI LITT						
Visc @ 40°C	cSt	ASTM D445	46	46.3	46.5	


Color		no image
Bottom		no image

GRAPHS

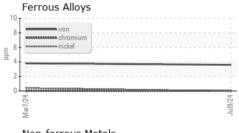

-rerro		et																				
cop	per																					
nit assesse	_																					
		 -	 		~~~						***		**						::			\$
																					0.01	7/6/In/
			 copper	copper	copper copper lead	copper copper lead	copper copper lead	copper lead tin	copper copper tin	copper lead tin	copper	copper lead	copper lead tin	copper lead	copper lead	copper lead tin	copper lead	copper	copper	copper lead tin	copper lead	copper

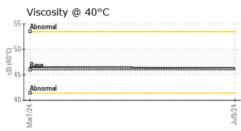

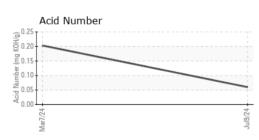





Certificate 12367

Test Package : IND 2

Sample No. : UHK06237909 Lab Number : 06237909

Unique Number : 11126743

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Tested

Received : 16 Jul 2024 Diagnosed

: 17 Jul 2024 : 18 Jul 2024 - Sean Felton

123 MERCHANTS PARK DR HOSCHTON, GA

ATLANTA AIR COMPRESSOR - HERTZ

US 30548 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: Service Manager - UCATLHER

T:

F: