


# **OIL ANALYSIS REPORT**

Sample Rating Trend





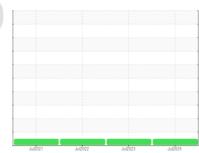

# SYNOIL 8K FG **1092 - BEL BRANDS**

Component Compressor

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	NATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCZ06237925	UCZ05901915	UCZ05589631
Sample Date		Client Info		02 Jul 2024	05 Jul 2023	06 Jul 2022
Machine Age	hrs	Client Info		76024	76017	75687
Oil Age	hrs	Client Info		7	330	100
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	0
Chromium	ppm	ASTM D5185m	>5	0	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>15	0	<1	1
Lead	ppm	ASTM D5185m	>65	0	0	<1
Copper	ppm	ASTM D5185m	>65	0	<1	<1
Tin	ppm	ASTM D5185m	>10	0	0	<1
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	1	0	0	<1
Barium	ppm	ASTM D5185m	0.3	0	0	2
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m	0	0	0	0
Magnesium	ppm	ASTM D5185m	0	0	<1	0
Calcium	ppm	ASTM D5185m	0.5	0	0	0
Phosphorus	ppm	ASTM D5185m	536	337	519	436
Zinc	ppm	ASTM D5185m	0.2	6	7	4
Sulfur	ppm	ASTM D5185m	649	1281	1452	649
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	<1	0	1
Sodium	ppm	ASTM D5185m		1	0	0
Potassium	ppm	ASTM D5185m	>20	0	<1	<1
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.337	0.29	0.30	0.27




## **OIL ANALYSIS REPORT**

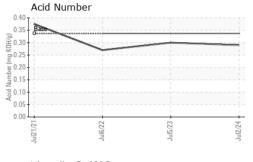


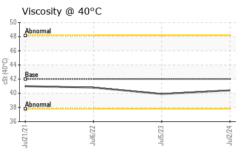



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	42.0	40.4	39.9	40.8
SAMPLE IMAGES		method	limit/base	current	history1	history2
						Gar:


Color






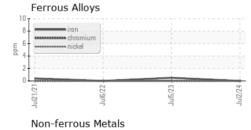





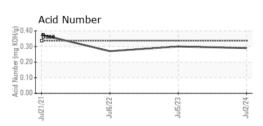





Certificate 12367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06237925

: UCZ06237925 Unique Number : 11126759 Test Package : IND 2

Received : 16 Jul 2024 **Tested** Diagnosed

: 17 Jul 2024 : 17 Jul 2024 - Wes Davis

**ZORN COMP & EQUIPMENT CO (GB)** 733 POTTS AVE GREEN BAY, WI US 54304

Contact: DEAN SCHAD dean.schad@zornair.com T: (920)391-8121

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCZORGRE [WUSCAR] 06237925 (Generated: 07/17/2024 09:42:25) Rev: 1

Contact/Location: DEAN SCHAD - UCZORGRE

F: (920)499-1168