




OIL ANALYSIS REPORT

Sample Rating Trend

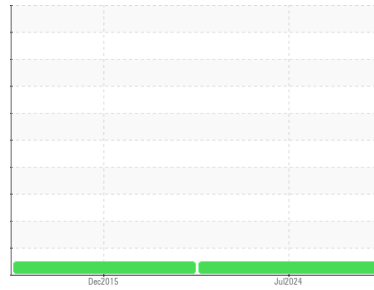

NORMAL



Area

624 [KP01000912]

Machine Id

CML 4 CAN LINE

Component

Hydraulic System

Fluid

AW HYDRAULIC OIL ISO 46 (--- GAL)

DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0936199	WCI2283429	---
Sample Date	Client Info			10 Jul 2024	01 Dec 2015	---
Machine Age	hrs	Client Info		0	0	---
Oil Age	hrs	Client Info		0	0	---
Oil Changed	Client Info			N/A	N/A	---
Sample Status				NORMAL	NORMAL	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	NEG	NEG	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	<1	<1	---
Chromium	ppm	ASTM D5185m	>20	0	<1	---
Nickel	ppm	ASTM D5185m	>20	0	0	---
Titanium	ppm	ASTM D5185m		0	0	---
Silver	ppm	ASTM D5185m		0	0	---
Aluminum	ppm	ASTM D5185m	>20	0	0	---
Lead	ppm	ASTM D5185m	>20	0	0	---
Copper	ppm	ASTM D5185m	>20	2	<1	---
Tin	ppm	ASTM D5185m	>20	0	0	---
Antimony	ppm	ASTM D5185m		---	<1	---
Vanadium	ppm	ASTM D5185m		0	0	---
Cadmium	ppm	ASTM D5185m		0	0	---





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0	0	---
Barium	ppm	ASTM D5185m	5	0	0	---
Molybdenum	ppm	ASTM D5185m	5	0	<1	---
Manganese	ppm	ASTM D5185m		0	0	---
Magnesium	ppm	ASTM D5185m	25	1	2	---
Calcium	ppm	ASTM D5185m	200	35	66	---
Phosphorus	ppm	ASTM D5185m	300	339	313	---
Zinc	ppm	ASTM D5185m	370	409	395	---
Sulfur	ppm	ASTM D5185m	2500	954	710	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1	<1	---
Sodium	ppm	ASTM D5185m		<1	1	---
Potassium	ppm	ASTM D5185m	>20	0	0	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	498	703	---
Particles >6µm		ASTM D7647	>1300	189	383	---
Particles >14µm		ASTM D7647	>160	19	65	---
Particles >21µm		ASTM D7647	>40	5	22	---
Particles >38µm		ASTM D7647	>10	0	3	---
Particles >71µm		ASTM D7647	>3	0	0	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	16/15/11	17/16/13	---



OIL ANALYSIS REPORT

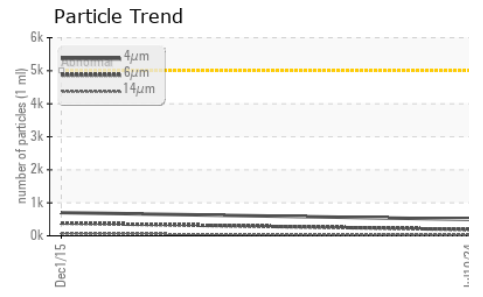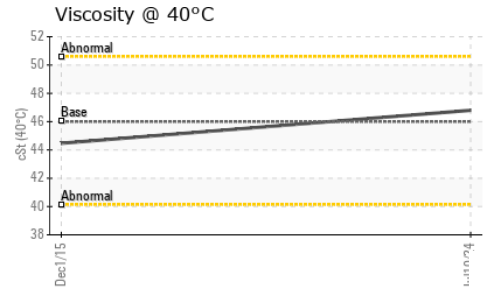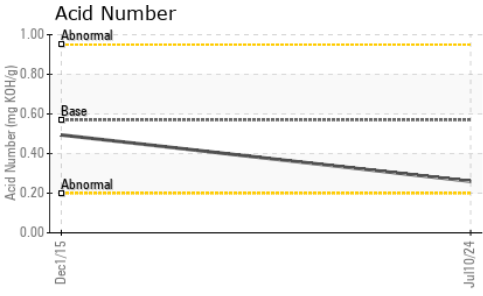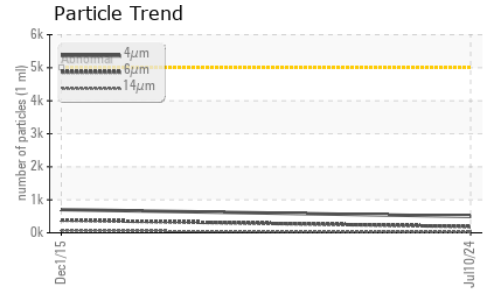

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.57	0.26	0.494	---






VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	VLITE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	---
Free Water	scalar	*Visual		NEG	NEG	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	46.8	44.47	---

SAMPLE IMAGES

method	limit/base	current	history1	history2
Color			no image	no image
Bottom			no image	no image

GRAPHS

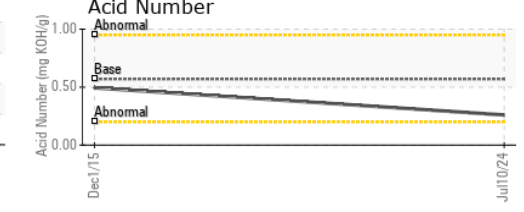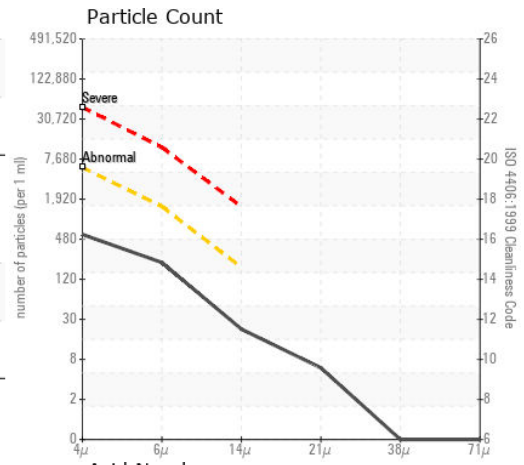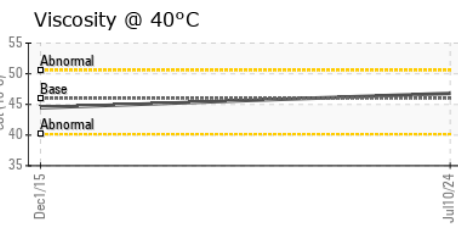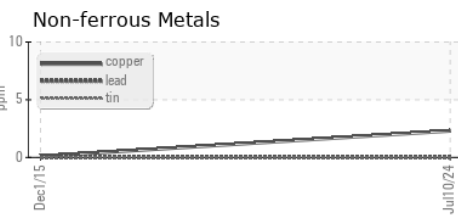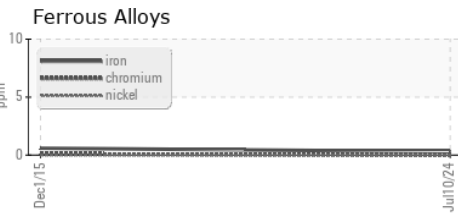

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0936199 **Received** : 17 Jul 2024
Lab Number : **06239114** **Tested** : 18 Jul 2024
Unique Number : 11127948 **Diagnosed** : 18 Jul 2024 - Wes Davis
Test Package : IND 2

BALDWIN FILTERS INC
 4400 HIGHWAY 30 EAST
 KEARNEY, NE
 US 68847-0724
 Contact: JAY FAHRENBRUCH
 jay.fahrenbruch@parker.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (800)828-4453