


VISUEL	methode	limite/base	actuel	passé1	passé2
Métal blanc	scalar	Visual*	NONE	<b>NONE</b>	---
Bronze	scalar	Visual*	NONE	<b>NONE</b>	---
Précipié	scalar	Visual*	NONE	<b>NONE</b>	---
Limon	scalar	Visual*	NONE	<b>NONE</b>	---
Débris	scalar	Visual*	NONE	<b>NONE</b>	---
Saleté	scalar	Visual*	NONE	<b>NONE</b>	---
Apparence	scalar	Visual*	NORML	<b>NORML</b>	---
Odeur	scalar	Visual*	NORML	<b>NORML</b>	---

PROPRIÉTÉS DU FLUID	methode	limite/base	actuel	passé1	passé2
Visc 40°C	cSt	ASTM D7279(m)	47.0	<b>46.5</b>	---
Visc 100°C	cSt	ASTM D7279(m)	8.1	<b>8.5</b>	---
Indice de viscosité (VI)	Scale	ASTM D2270*	146	<b>161</b>	---

IMAGES DE L'ÉCHANTILLON	methode	limite/base	actuel	passé1	passé2
-------------------------	---------	-------------	--------	--------	--------

Coluer		no image	no image
Fond		no image	no image

## GRAPHIQUES

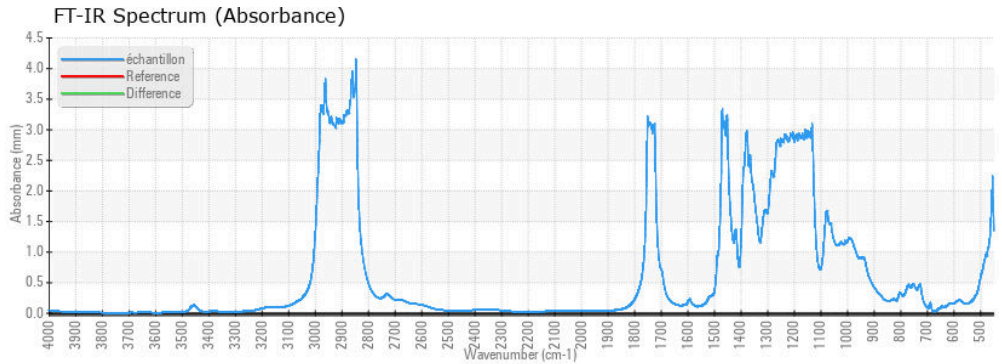

ISO 17025:2017  
Accredited  
Laboratory

**Laboratoire** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**N° d'échantillon** : WC  
**N° de laboratoire** : **02638978**  
**Numéro unique** : 5788140  
**Analyse** : TEST ( Additional Tests: ICP-NewOil )

**Reçu** : 30 May 2024  
**Tested** : 31 May 2024  
**Diagnostiqué** : 06 Jun 2024 - Bill Quesnel

**Envirolin Canada**  
 520 rue Adanac  
 Quebec, QC  
 CA G1C 7B7

Contact: Patrick Levesque  
 patrick.levesque@envirolin.com

T: (418)623-1216  
 F: (418)660-8889

Pour discuter cette rapport, contacter le service à la clientèle au 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

La validez de los resultados y la interpretación se basan en la muestra y la información proporcionada.