


PROBLEM SUMMARY

Sample Rating Trend



ISO

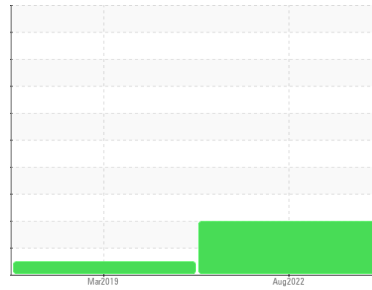


Machine Id
KAESER SM 10T 4874975 (S/N 1236)

Component
Compressor

Fluid
KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

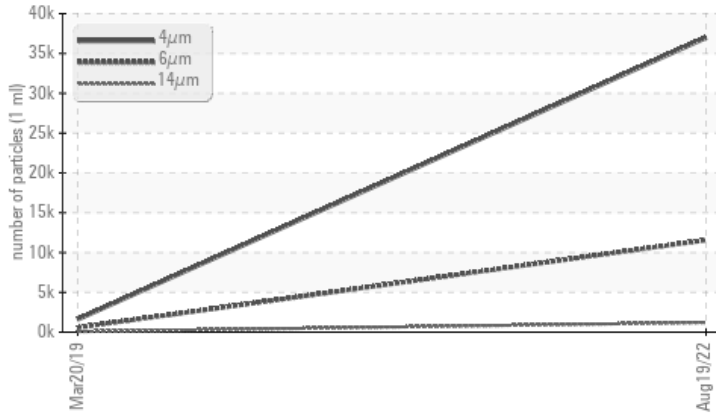

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	NORMAL	---
Particles >6µm	ASTM D7647	>1300	▲ 11557	569	---
Particles >14µm	ASTM D7647	>80	▲ 1210	66	---
Particles >21µm	ASTM D7647	>20	▲ 284	17	---
Particles >38µm	ASTM D7647	>4	▲ 26	2	---
Oil Cleanliness	ISO 4406 (c)	>--/17/13	▲ 22/21/17	16/13	---

Customer Id: CARGLEVA
Sample No.: KCP37307
Lab Number: 05623850
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Fluid	---	---	?	Oil and filter change at the time of sampling has been noted.
Change Filter	---	---	?	Oil and filter change at the time of sampling has been noted.

HISTORICAL DIAGNOSIS

20 Mar 2019 Diag: Doug Bogart

NORMAL




No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



Machine Id
KAESER SM 10T 4874975 (S/N 1236)

Component
Compressor
Fluid
KAESER SIGMA (OEM) M-460 (--- GAL)

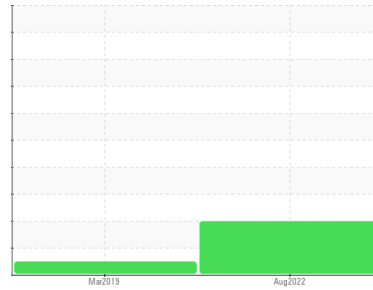

DIAGNOSIS

▲ Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

▲ Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history 1	history 2
Sample Number			KCP37307	KCP00230	---
Sample Date			19 Aug 2022	20 Mar 2019	---
Machine Age	hrs		36554	23863	---
Oil Age	hrs		3000	5432	---
Oil Changed			Changed	Changed	---
Sample Status			ABNORMAL	NORMAL	---

WEAR METALS

	method	limit/base	current	history 1	history 2
Iron	ppm ASTM D5185m	>50	<1	0	---
Chromium	ppm ASTM D5185m	>10	0	0	---
Nickel	ppm ASTM D5185m	>3	0	0	---
Titanium	ppm ASTM D5185m	>3	0	0	---
Silver	ppm ASTM D5185m	>2	0	<1	---
Aluminum	ppm ASTM D5185m	>10	<1	<1	---
Lead	ppm ASTM D5185m	>10	0	0	---
Copper	ppm ASTM D5185m	>50	6	8	---
Tin	ppm ASTM D5185m	>10	0	0	---
Antimony	ppm ASTM D5185m		---	0	---
Vanadium	ppm ASTM D5185m		0	0	---
Cadmium	ppm ASTM D5185m		0	0	---

ADDITIVES

	method	limit/base	current	history 1	history 2
Boron	ppm ASTM D5185m	0	0	0	---
Barium	ppm ASTM D5185m	90	0	0	---
Molybdenum	ppm ASTM D5185m	0	0	0	---
Manganese	ppm ASTM D5185m		0	0	---
Magnesium	ppm ASTM D5185m	100	39	0	---
Calcium	ppm ASTM D5185m	0	0	0	---
Phosphorus	ppm ASTM D5185m	0	2	0	---
Zinc	ppm ASTM D5185m	0	39	0	---
Sulfur	ppm ASTM D5185m	23500	20740	13243	---

CONTAMINANTS

	method	limit/base	current	history 1	history 2
Silicon	ppm ASTM D5185m	>25	<1	<1	---
Sodium	ppm ASTM D5185m		9	<1	---
Potassium	ppm ASTM D5185m	>20	0	0	---
Water	% ASTM D6304	>0.05	0.016	0.002	---
ppm Water	ppm ASTM D6304	>500	166.5	20	---


FLUID CLEANLINESS

	method	limit/base	current	history 1	history 2
Particles >4µm	ASTM D7647		36981	1595	---
Particles >6µm	ASTM D7647	>1300	▲ 11557	569	---
Particles >14µm	ASTM D7647	>80	▲ 1210	66	---
Particles >21µm	ASTM D7647	>20	▲ 284	17	---
Particles >38µm	ASTM D7647	>4	▲ 26	2	---
Particles >71µm	ASTM D7647	>3	1	0	---
Oil Cleanliness	ISO 4406 (c)	>--/17/13	▲ 22/21/17	16/13	---

FLUID DEGRADATION

	method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g ASTM D8045	1.0	0.34	0.427	---


OIL ANALYSIS REPORT

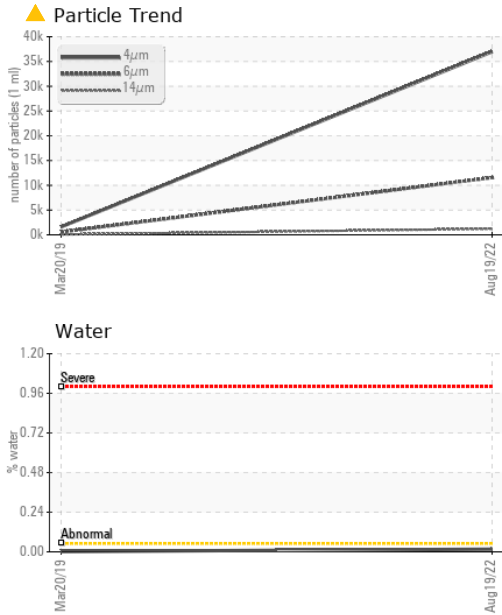





VISUAL	method	limit/base	current	history 1	history 2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	LIGHT	VLITE
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history 1	history 2
Visc @ 40°C	cSt	ASTM D445	45	51.0	49.21

SAMPLE IMAGES	method	limit/base	current	history 1	history 2
---------------	--------	------------	---------	-----------	-----------

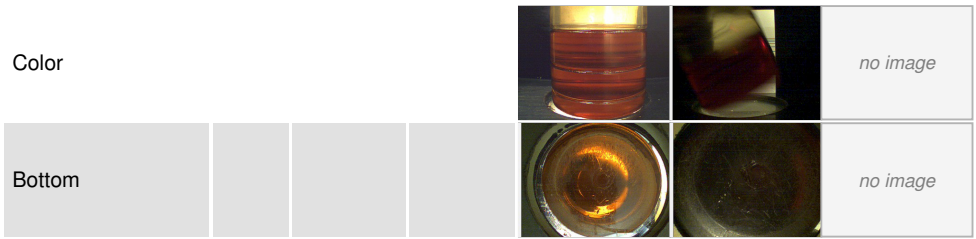

GRAPHS

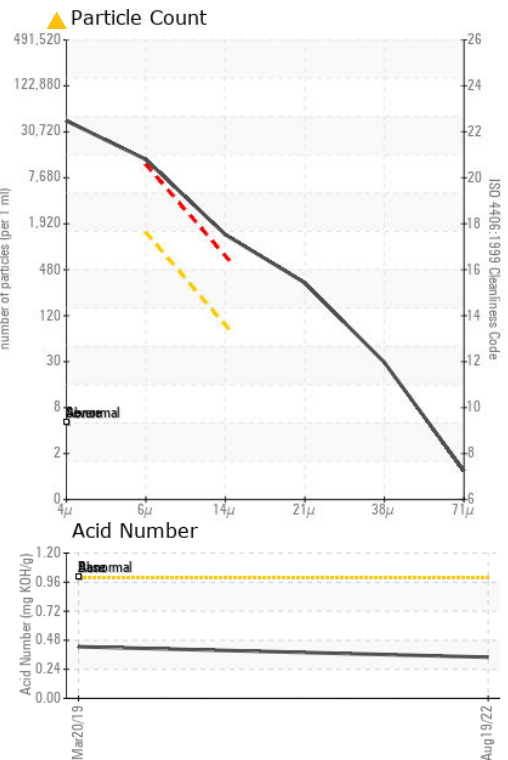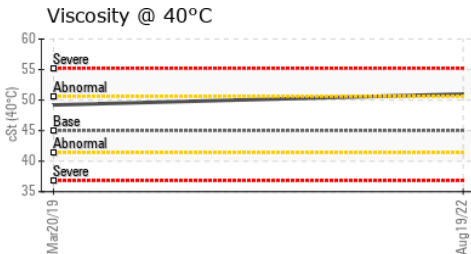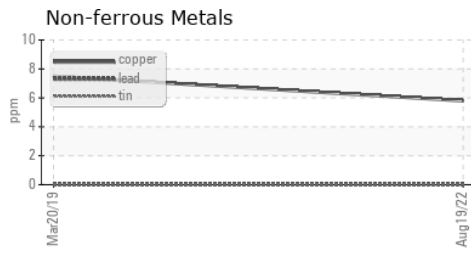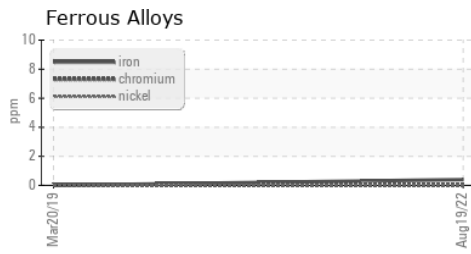

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KCP37307 **Received** : 22 Aug 2022
Lab Number : 05623850 **Diagnosed** : 24 Aug 2022
Unique Number : 10103357 **Diagnostician** : Don Baldrige
Test Package : IND 2 (Additional Tests: KF, PrtCount)

CARMAX
 11090 W BROAD ST
 GLEN ALLEN, VA
 USA 23060
 Contact: SERVICE MANAGER

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)