

# **PROBLEM SUMMARY**

Sample Rating Trend

WATER



7550912 (S/N 1556)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

### **COMPONENT CONDITION SUMMARY**



### RECOMMENDATION

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS							
Sample Status				ABNORMAL			
Water	%	ASTM D6304	>0.05	<b>△</b> 0.300			
ppm Water	ppm	ASTM D6304	>500	<b>3000</b>			
Debris	scalar	*Visual	NONE	▲ MODER			
Appearance	scalar	*Visual	NORML	▲ HAZY			
Emulsified Water	scalar	*Visual	>0.05	<b>0.2%</b>			

Customer Id: LOTSIL Sample No.: KCP50609 Lab Number: 05629636 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Oil and filter change at the time of sampling has been noted.		
Change Filter			?	Oil and filter change at the time of sampling has been noted.		
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.		



# **OIL ANALYSIS REPORT**

Sample Rating Trend



7550912 (S/N 1556)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

## **DIAGNOSIS**

#### Recommendation

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

#### Wear

All component wear rates are normal.

#### Contamination

Moderate concentration of visible dirt/debris present in the oil. There is a light concentration of water present in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid.

				Aug <sup>2</sup> 022	<u> </u>	
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP50609		
Sample Date				22 Aug 2022		
Machine Age	hrs			2324		
Oil Age	hrs			2324		
Oil Changed				Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	<1		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	3		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	1		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	22		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	3		
Zinc	ppm	ASTM D5185m	0	3		
Sulfur	ppm	ASTM D5185m	23500	17102		
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	<b>△</b> 0.300		
ppm Water	ppm	ASTM D6304	>500	▲ 3000		
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
Asid Number (ANI)	ma 1/011/-	ACTM DODAE	1.0	0.20		

0.30

Acid Number (AN)

mg KOH/g ASTM D8045 1.0



## **OIL ANALYSIS REPORT**




VISUAL		method	limit/base	current	history 1	history 2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	▲ MODER		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	▲ HAZY		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.05	<b>0.2%</b>		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TES	method	limit/base	current	history 1	history 2
Visc @ 40°C	cSt	ASTM D445	45	43.7		
SAMPLE IMAGES	3	method	limit/base	current	history 1	history 2


Color	no image	no image
Bottom	no image	no image

#### **GRAPHS**





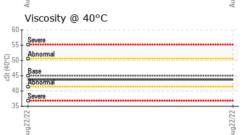

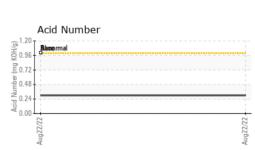





Laboratory Sample No. Lab Number Unique Number : 10114157

: KCP50609 : 05629636

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 29 Aug 2022 : 31 Aug 2022 Diagnostician : Don Baldridge

**Test Package**: IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**LOTUS LIGHT ENTERPRISES** 

1100 LOTUS DR SILVER LAKE, WI USA 53170

Contact: Service Manager

T: F: