

PROBLEM SUMMARY

DV

Sample Rating Trend

ISO


KAESER 6593534

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

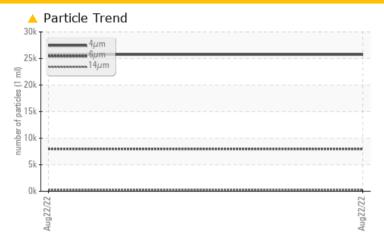

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TE	ST RESULTS			
Sample Status			ABNORMAL	
Particles >6µm	ASTM D7647	>1300	^ 7974	
Particles >14µm	ASTM D7647	>80	256	
Particles >21µm	ASTM D7647	>20	4 35	
Oil Cleanliness	ISO 4406 (c)	>/17/13	22/20/15	

Customer Id: HOLFORPA Sample No.: KCP33374 Lab Number: 05635070 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDE	O ACTIONS			
Action	Status	Date	Done By	Description
Change Fluid			?	Oil and filter change at the time of sampling has been noted.
Change Filter			?	Oil and filter change at the time of sampling has been noted.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Machine Id

KAESER 6593534

KAESER SIGMA (OEM) M-460 (--- GAL)

Component Compressor

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

▲ Contamination

There is a high amount of particulates present in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

•	Samp	le Rating Trend	l 		ISO
		Aug 20	22		
N	method	limit/base	current	history 1	history 2

SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP33374		
Sample Date				22 Aug 2022		
Machine Age	hrs			16934		
Oil Age	hrs			16934		
Oil Changed				Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	29		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	9		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	2		
Zinc	ppm	ASTM D5185m	0	34		
Sulfur	ppm	ASTM D5185m	23500	14101		
CONTAMINANTS)	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m	720	11		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.026		
ppm Water	ppm	ASTM D6304	>500	264.8		
FLUID CLEANLIN	IESS	method	limit/base	current	history 1	history 2
Particles >4µm		ASTM D7647		25734		
Particles >6μm		ASTM D7647	>1300	△ 7974		
Particles >14µm		ASTM D7647	>80	<u></u>		
Particles >14µm		ASTM D7647	>20	△ 35		
Particles >38µm		ASTM D7647 ASTM D7647	>4	2		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u> </u>		
FLUID DEGRADA	TION					
		method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.28		




OIL ANALYSIS REPORT

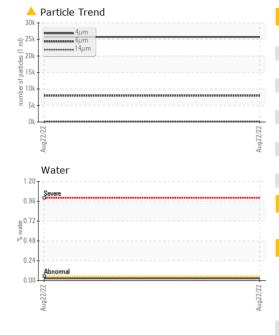

VISUAL		method	limit/base	current	history 1	history 2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.05	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IES	method	limit/base	current	history 1	history 2
Visc @ 40°C	cSt	ASTM D445	45	44.1		
SAMPLE IMAGES	3	method	limit/base	current	history 1	history 2

no image no image
no image no image
Particle Count 491,520 122,880 -24

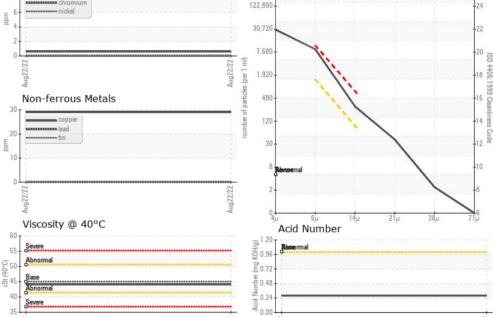





Laboratory Sample No. Lab Number Unique Number : 10124600

: KCP33374 : 05635070

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

Diagnosed Diagnostician : Don Baldridge

: 06 Sep 2022 : 08 Sep 2022

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

HOLMAN PA AUTOMOTIVE LLC

428 PENNSYLVANIA AVE FORT WASHINGTON, PA USA 19034

Contact: Service Manager

T: F: