

PROBLEM SUMMARY

Sample Rating Trend

WATER

WAIEN


4675951 (S/N 1441)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

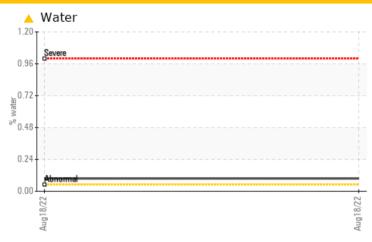

RECOMMENDATION

The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Water	%	ASTM D6304	>0.05	△ 0.096				
ppm Water	ppm	ASTM D6304	>500	4 960				
Silt	scalar	*Visual	NONE	MODER				

Customer Id: STAMTA Sample No.: KC05637690 Lab Number: 05637690 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS								
Action	Status	Date	Done By	Description				
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.				
HISTORICAL DIAGNOSIS								



OIL ANALYSIS REPORT



WATER



4675951 (S/N 1441)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

All component wear rates are normal.

Contamination

There is a light concentration of water present in the oil. There is a moderate amount of visible silt present in the sample.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Aug2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KC05637690		
Sample Date				18 Aug 2022		
Machine Age	hrs			0		
Oil Age	hrs			0		
Oil Changed	1110			N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base		history 1	history 2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	<1		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead		ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium		ASTM D5185m	>10	0		
Cadmium	ppm	ASTM D5185m		0		
	ppm					
ADDITIVES		method	limit/base		history 1	history 2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	<1		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	90	10		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		18		
Zinc	ppm	ASTM D5185m		50		
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.096		
ppm Water	ppm	ASTM D6304	>500	<u></u> 4960		
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.22		
VISUAL		method	limit/base	current	history 1	history 2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	▲ MODER		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.05	0.2%		
Free Water	scalar	*Visual		NEG	on: Service Mar	agerSTAMTA





OIL ANALYSIS REPORT

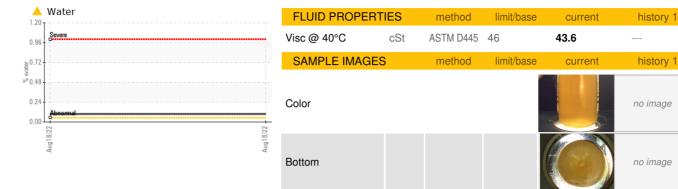


GRAPHS

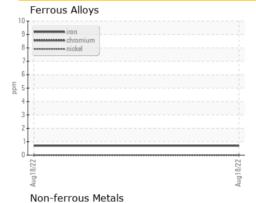

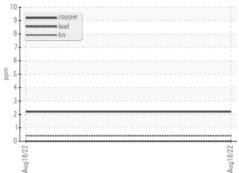

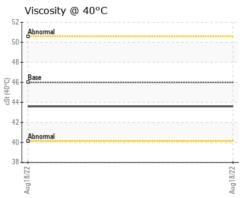

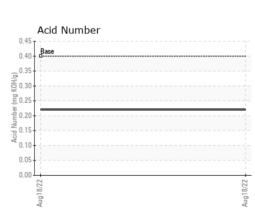



Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10127220 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : KC05637690 : 05637690

Received Diagnosed

Diagnostician : Jonathan Hester

: 09 Sep 2022 : 12 Sep 2022 **STAR EQUIPMENT** 2195 CODY RD MT AIRY, GA

history 2

history 2

no image

no image

USA 30563 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: