

PROBLEM SUMMARY

Sample Rating Trend

WATER



Machine Id **7441137 (S/N 1140)**

Component Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY



RECOMMENDATION

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Water	%	ASTM D6304	>0.05	△ 0.220				
ppm Water	ppm	ASTM D6304	>500	2200				
Debris	scalar	*Visual	NONE	▲ MODER				
Appearance	scalar	*Visual	NORML	▲ HAZY				

Customer Id: ONDROC Sample No.: KCP49018 Lab Number: 05645547 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com


RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Fluid			?	Oil and filter change at the time of sampling has been noted.			
Change Filter			?	Oil and filter change at the time of sampling has been noted.			
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

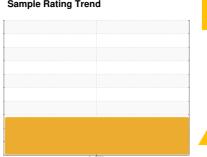

WATER



7441137 (S/N 1140)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

Wear

All component wear rates are normal.

Contamination

Appearance is hazy. There is a light concentration of water present in the oil. Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP49018		
Sample Date				12 Sep 2022		
Machine Age	hrs			3478		
Oil Age	hrs			1800		
Oil Changed				Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	<1		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm	ASTM D5185m	>50	4		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	11		
Calcium	ppm	ASTM D5185m	0	<1		
Phosphorus	ppm	ASTM D5185m	0	5		
Zinc	ppm	ASTM D5185m	0	57		
Sulfur	ppm	ASTM D5185m	23500	17002		
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	1		
Water	%	ASTM D6304	>0.05	<u> </u>		
ppm Water	ppm	ASTM D6304	>500	2200		
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.20		




OIL ANALYSIS REPORT




VISUAL		method	limit/base	current	history 1	history 2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	▲ MODER		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	HAZY		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.05	0.2%		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TES	method	limit/base	current	history 1	history 2
Visc @ 40°C	cSt	ASTM D445	45	43.7		
SAMPLE IMAGES	3	method	limit/base	current	history 1	history 2


Color			no image	no image
Bottom			no image	no image
CDADUC				

GRAPHS

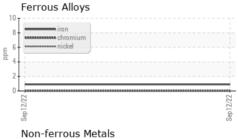

Non-ferrous Metals		
l , ,		
copper		
- management tin		
Sep12/22.		Sep12/22
	copper	copper

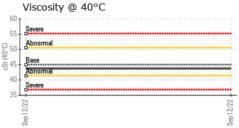

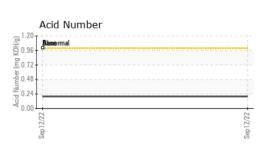





Laboratory Sample No. Lab Number Unique Number : 10140086

: KCP49018 : 05645547

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 19 Sep 2022

Diagnosed : 21 Sep 2022 Diagnostician : Jonathan Hester

Test Package: IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ON DEMAND PHARMACEUTICALS INC

1550 E GUDE DR ROCKVILLE, MD USA 20850

Contact: Service Manager

T:

F: