

PROBLEM SUMMARY

Sample Rating Trend

ISO


KAESER 4138355

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

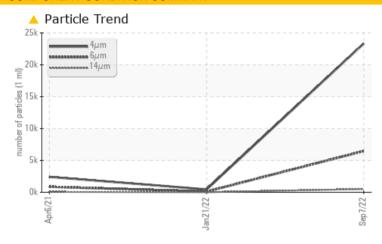

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS							
Sample Status			ABNORMAL	NORMAL	NORMAL		
Particles >6µm	ASTM D7647	>1300	460	104	864		
Particles >14µm	ASTM D7647	>80	<u></u> 502	10	66		
Particles >21µm	ASTM D7647	>20	<u> </u>	4	16		
Oil Cleanliness	ISO 4406 (c)	>/17/13	22/20/16	14/10	17/13		

Customer Id: BARSTL Sample No.: KCP30934 Lab Number: 05646619 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 ihester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.

HISTORICAL DIAGNOSIS

21 Jan 2022 Diag: Don Baldridge

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



06 Apr 2021 Diag: Don Baldridge

NORMAL




Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

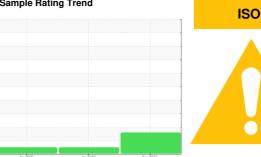

KAESER 4138355

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Apr2021 Jan2022			Sep2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2	
Sample Number				KCP30934	KCP48549	KCP32891	
Sample Date				07 Sep 2022	21 Jan 2022	06 Apr 2021	
Machine Age	hrs			21940	20007	17434	
Oil Age	hrs			1900	3000	2500	
Oil Changed				Not Changd	Changed	Not Changd	
Sample Status				ABNORMAL	NORMAL	NORMAL	
WEAR METALS		method	limit/base	current	history 1	history 2	
Iron	ppm	ASTM D5185m	>50	0	0	0	
Chromium	ppm	ASTM D5185m	>10	0	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	0	
Silver	ppm	ASTM D5185m	>2	0	0	0	
Aluminum	ppm	ASTM D5185m	>10	<1	<1	0	
Lead	ppm	ASTM D5185m	>10	0	0	<1	
Copper	ppm	ASTM D5185m	>50	4	3	1	
Tin	ppm	ASTM D5185m	>10	0	0	<1	
Antimony	ppm	ASTM D5185m			0	0	
Vanadium	ppm	ASTM D5185m		0	0	0	
Cadmium	ppm	ASTM D5185m		0	0	0	
ADDITIVES		method	limit/base	current	history 1	history 2	
Boron	ppm	ASTM D5185m	0	0	0	10	
Barium	ppm	ASTM D5185m	90	5	4	43	
Molybdenum	ppm	ASTM D5185m	0	0	0	0	
Manganese	ppm	ASTM D5185m		<1	0	0	
Magnesium	ppm	ASTM D5185m	100	71	73	87	
Calcium	ppm	ASTM D5185m	0	1	1	2	
Phosphorus	ppm	ASTM D5185m	0	4	2	7	
Zinc	ppm	ASTM D5185m	0	5	4	0	
Sulfur	ppm	ASTM D5185m	23500	20766	16746	17636	
CONTAMINANTS	3	method	limit/base	current	history 1	history 2	
Silicon	ppm	ASTM D5185m	>25	<1	0	0	
Sodium	ppm	ASTM D5185m		18	22	17	
Potassium	ppm	ASTM D5185m	>20	2	0	3	
Water	%	ASTM D6304	>0.05	0.026	0.011	0.020	
ppm Water	ppm	ASTM D6304	>500	267.2	119.5	209.3	
FLUID CLEANLIN	IESS	method	limit/base	current	history 1	history 2	
Particles >4μm		ASTM D7647		23337	444	2414	
Particles >6µm		ASTM D7647	>1300	460	104	864	
Particles >14μm		ASTM D7647	>80	▲ 502	10	66	
Particles >21μm		ASTM D7647	>20	<u></u> 91	4	16	
Particles >38μm		ASTM D7647	>4	3	0	0	
Particles >71μm		ASTM D7647	>3	0	0	0	
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>22/20/16</u>	14/10	17/13	
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2	
A -1-I NI (AAD)	1/01//	10711 00015	4.0	0.05	0.40	0.010	

0.40


0.35

0.342




0.00

OIL ANALYSIS REPORT

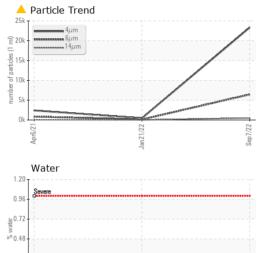

VISUAL		method	limit/base	current	history 1	history 2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERT	ΓIES	method	limit/base	current	history 1	history 2
Visc @ 40°C	cSt	ASTM D445	45	44.4	44.4	44.3
SAMPLE IMAGES	S	method	limit/base	current	history 1	history 2
Color						
Bottom						

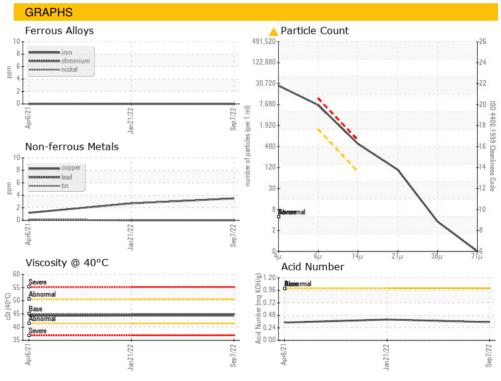





Laboratory Sample No. Lab Number Unique Number : 10141158

: KCP30934 : 05646619

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

: 20 Sep 2022 Diagnosed : 22 Sep 2022 Diagnostician : Jonathan Hester

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

BARNES JEWISH HOSPITAL

4540 FOREST PARK AVE ST LOUIS, MO

USA 63108 Contact: Service Manager

> T: F: